



Addendum #3

Bid Opportunity: 7251-RW-22

Waterloo Oxford District Secondary School - Family Studies

Renovation & HVAC Upgrades

Closing Date: Monday, April 11, 2022 2:00 PM

The following issued by the Board shall form part of the Bid / Proposal Solicitation document. The revisions and additions noted herein along with any attachments shall be read in conjunction with all other related documents. This Addendum shall, take precedence over the previously issued documents where differences occur. Receipt of this addendum must be acknowledged in the Bidding System, bids&tenders.

If you have already submitted a Bid / Proposal, it will be automatically withdrawn as a result of this addendum. You must resubmit the Bid / Proposal acknowledging all addenda and revising your Bid / Proposal to comply with all addenda.

The information below, attachments and drawings provide additional clarification and does not change the Scope or intent of the bid document.

Section 1 – Clarification / Initiated by the Board

The information below, attachments and drawings provide additional clarification and does not change the Scope or intent of the bid document.

1.1 ARCHITECTURAL SPECIFICATIONS

1. Section 00 21 13 Instruction to Bidders

1. REVISE Table 1.18. - Anticipated Timetable as follows:

Closing Deadline to be extended to **MONDAY APRIL 11, 2022 @ 2:00 pm local time.**

Note: Closing Date and Time on Bid Form and Closing Date and Closing Deadline on Specification Cover Sheet to be updated to **MONDAY APRIL 11, 2022 @ 2:00 pm local time.**

2. Section 01 35 43A Appendix 013543A Asbestos Audit
 1. REPLACE 2018 Asbestos Audit Update with **2021 Asbestos Audit Update** (57 pages), attached.

Note that in addition to items identified in the Audit, that ductwork remaining in the Work Area and identified to be removed on the Mechanical Drawings, requires Type 3 Abatement procedures.

- End of Addendum #3 –

+ MTE 2021 Asbestos Audit Update Report



Waterloo Oxford District Secondary School

2021 Asbestos Audit Update Report

Project Location:

1206 Snyder's Road, Baden, ON

Prepared for:

Waterloo Region District School Board
51 Ardelt Avenue, Kitchener, ON

Prepared by:

MTE Consultants
520 Bingemans Centre Drive
Kitchener, ON N2B 3X9

July 13 2021

Revised: April 4, 2022

MTE File No.: C34532-921



MTE Consultants
520 Bingemans Centre Drive, Kitchener, Ontario N2B 3X9

July 13, 2021

Rev: April 4, 2022

MTE File No.: C34532-921

Waterloo Region District School Board
51 Ardelt Avenue
Kitchener, ON N2C 2R5

**RE: 2021 Asbestos Audit Update – Waterloo Oxford District Secondary School
1206 Snyder's Road, Baden, Ontario**

1.0 Introduction

MTE Consultants Inc. (MTE) was authorized by the Waterloo Region District School Board (WRDSB) to conduct the 2021 Asbestos Audit Update for the subject building.

The purpose of the assignment was to re-assess and document the location, type, and condition of identified asbestos-containing materials (ACM) present within the building and make appropriate recommendations for management, abatement or remedial activities, as required.

The audit was conducted in accordance with the Ontario Ministry of Labour, *Regulation 278/05-Designated Substance-Asbestos on Construction Projects and in Buildings and Repair Operations* (O. Reg. 278/05). This report shall replace previous audit reports.

2.0 Scope of Work

The Scope of Work for this assessment was completed by MTE and included the following activities:

- Review of existing and historical reports and documentation pertaining to ACM within the building;
- Visual inspection to assess the condition of previously identified ACM, excluding portable structures;
- Collection of building material samples that are suspect ACM, as applicable;
- Submission of samples to an accredited laboratory, as applicable;
- Photographic log of damaged materials; and
- Preparation of this report with findings and recommendations.

3.0 Methodology and Assessment Criteria

This inspection was conducted by visual and laboratory identification methods for the assessment of ACM and their corresponding location, use, condition, and friability. The areas outlined in Section 2.0 were inspected limited to building components, materials and service connections. Notwithstanding that reasonable attempts were made to identify all ACMs, the possibility of concealed material exists and may not become visible until substantial demolition has occurred and therefore are currently undocumented and did not include the following.

- Locations that may be hazardous to the surveyor, such as electrical equipment;
- Where invasive inspection could cause consequential damage to the property or impair the integrity of the equipment, such as roof systems, underground services or components of mechanical equipment;
- Locations concealed by building finishes that require substantial demolition or removal for access or determination of quantities;
- Materials that are present in such an inconsistent fashion that without complete removal of finishes, the extent cannot be determined.
- Non-permanent items or personal contents, furnishings; and
- Settled dust or airborne agents unless otherwise stated.

3.1 Condition of ACM

During the audit process the general condition of ACMs were observed and noted. Materials which are damaged can pose an increased exposure risk to workers, building occupants and the public. While assessing damage can be subjective, abatement items were grouped into two categories to aid in remedial prioritization.

Monitor Annually

These are items which display minor isolated damage; however, do not pose an immediate risk to workers from exposure to asbestos fibres due to the current condition of the material and/or location. No remediation is required at this time; however, these items should be monitored on a yearly basis for evidence of continued degradation. Should the condition of the material change, an evaluation should be completed by a competent person to determine remedial action.

Abatement Action Required

These are items which display damage and may pose potential risk to workers from exposure to asbestos fibres due to the physical condition and/or location of the material. Clean-up, repair or removal of these materials is required as soon as reasonably possible.

4.0 Findings

Inspections of the building were conducted by MTE on July 5-6, 2021 and March 29, 2022. The two-storey school was constructed in 1955 with additions in 1958, 1962, 1966, 1971, 1972, 2000, 2001, and 2011. The inspection did not include areas of post 1990 construction or renovation (where all building finishes have been removed and replaced), as applicable.

The Asbestos Management Database is provided in **Appendix A** and associated Figures are provided in **Appendix B**. These together provide a current summary of the ACM identified throughout the building.

A summary of the damaged ACM identified at the time of the inspection is provided in **Appendix C**.

The bulk asbestos sample location and analytical summary is provided in **Appendix C**.

4.1 Analytical Results

During this inspection, no samples were collected.

4.2 Removed ACM

A summary of ACM that has been removed since the previous audit/inspection is provided below:

WRDSB Room 124.

- All Vinyl floor tile 9"x 9 – grey with white streak and associated mastic.

WRDSB Room 104, 122, 128.

- All Vinyl floor tile 9"x 9 – olive with white fleck and associated mastic.

WRDSB Room 103B, 103D, 101 and 126.

- All Vinyl floor tile 9"x 9" – grey with white, black, red fleck and associated mastic.

WRDSB Room 404, 404A, 404B, 404C, 404D, 404E and 404F.

- All Vinyl floor tile 9"x 9" – tan with white and black fleck and associated mastic.

WRDSB Room 103E.

- All Vinyl sheet flooring and associated mastic.

WRDSB Room 101, 102, 102C, 103A, 103B, 103C, 103D, 103E, 103F, 104, 104C, 118, 118A, 120, 120A, 121, 122, 123, 124, 125, 126, 127, 128, 821, 901 and 902.

- All Spray-applied fire proofing on structural steel;
- All Pipe fittings; and
- All Drywall ceilings.

WRDSB Room 101, 102, 103A, 103B, 103C, 103D, 103E, 103F, 104, 104C, 121, 123, 125, 127, 901 and 902.

- All Ceiling tiles 1'x1' – medium and small pinhole.

WRDSB Room 803/809 intersection.

- 2 Pipe fittings.

4.3 Discovery of Additional ACM

No additional ACM or suspect ACM was identified.

4.4 Damaged ACM

Damaged ACM was identified. Refer to **Appendix C, Tables 1 and 2** for a detailed summary of required actions, specific to each material. At the time of the audit, all other ACM at the building was noted to be in good condition.

5.0 Recommendations

5.1 Remedial

Damaged ACM was identified. Refer to Appendix C, Tables 1 and 2 for a detailed summary of required actions, specific to each material. At the time of the audit, all other ACM at the building was noted to be in good condition.

Type 1 abatement Operations may be conducted internally by trained and qualified WRDSB staff. All other abatement work must be conducted by certified asbestos contractors trained and qualified to conduct the type of work required.

All asbestos work must be conducted by staff and/or contractors who are trained and experienced in the type of asbestos operations required, and should be overseen by a qualified third party Health, Safety and Environmental professional. In order to conduct Type 3 asbestos operations, contractors must be certified as Asbestos Abatement Workers AAW (Trade code 253W) and Asbestos Abatement Supervisors AAS (Trade code 253S) by The Ministry of Training, Colleges and Universities (Ministry of Advanced Education and Skills Development) as prescribed by Section 20 of O. Reg. 278/05.

5.2 Long Term Management

This audit was conducted for the long term management of ACM within the building. Prior to future construction or renovation projects, additional assessments and/or sampling may be required.

There are no requirements under current legislation to remove ACM from a building simply because it is present. However, O. Reg. 278/05 requires that an Asbestos Management Plan be implemented and maintained. Asbestos awareness training should be provided for staff that may come in contact with ACM during routine duties or in emergency situations.

ACM that will be disturbed, or will likely be disturbed, during building maintenance, renovations, construction, or demolition activities must be handled and disposed of in accordance with the procedures prescribed by O. Reg. 278/05.

ACM may also be present in concealed locations. If any construction, renovation, alteration, or maintenance activities are required or planned, invasive inspections of concealed locations for potential ACM must be performed prior to such activities. Should any suspect ACM be discovered, work should cease and the materials should not be disturbed. Suspect ACM must be treated as asbestos-containing or sampled and proven to not contain asbestos. Any activities that require disturbance of ACM must be performed in accordance with O. Reg. 278/05.

6.0 Limitations

Services performed by **MTE Consultants Inc.** (MTE) were conducted in a manner consistent with the level of care and skill ordinarily exercised by members of the Environmental Engineering & Consulting profession. No other representation expressed or implied as to the accuracy of the information, conclusions or recommendations is included or intended in this report.

This report was completed for the sole use of MTE and the Client. It was completed in accordance with the approved Scope of Work referred to in Section 0. As such, this report may not deal with all issues potentially applicable to the site and may omit issues that are or may be of interest to the reader. MTE makes no representation that the present report has dealt with all-important environmental features, except as provided in the Scope of Work. All findings and conclusions presented in this report are based on site conditions, as they existed during the time period of the investigation. This report is not intended to be exhaustive in scope or to imply a risk-free facility.

Any use which a third party makes of this report, or any reliance on, or decisions to be made based upon it, are the responsibility of such third parties. MTE accepts no responsibility for liabilities incurred by or damages, if any, suffered by any third party as a result of decisions made or actions taken, based upon this report. Others with interest in the site should undertake their own investigations and studies to determine how or if the condition affects them or their plans.

It should be recognized that the passage of time might affect the views, conclusions and recommendations (if any) provided in this report because environmental conditions of a property can change. Should additional or new information become available, MTE recommends that it be brought to our attention in order that we may re-assess the contents of this report.

All of which is respectfully submitted,

MTE Consultants Inc.

Michael Bennett, B.E.S.
Indoor Environments Technologist
519-743-6500 ext. 1459
mbennett@mte85.com

PXS: apm
Attach.

M:\34532\921\1 - Reports\0 - Ready For Review\Waterloo Oxford District S.S\Report 2021\34532-921_2022-04-04_Rpt - Asbestos Audit - Waterloo Oxford District Secondary School.docx

Paul Semeniuk, B.E.S., C.E.T.
Manager, Indoor Environments
519-743-6500 ext. 1324
psemeniuk@mte85.com

Appendix A

Asbestos Management Database



School Name Waterloo-Oxford District Secondary School Date Built: Original: 1955 Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011		Legend:					Notes:				
		HM - Homogenous Material - homogeneous with previously sampled material					All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.				
		SL - Sample Location - Material Sampled									
		VC - Visually Confirmed - Material not sampled, deemed ACM									
		NF - Non-Friable									
WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
Structure/Additions											
Original Building	Structure	Deck	Concrete		-	Non ACM	-	-	-	-	
Original Building	Structure	Concrete	Concrete		-	Non ACM	-	-	-	-	
Original Building	Façade	Brick Veneer	Brick and Mortar		-	Non ACM	-	-	-	-	
Original Building	Not Inspected	Not Inspected	Roofing Materials		NF	Suspect ACM	VC	-	-	-	
Original Building	Windows	Interior/Exterior Frames	Silicon Sealant		-	Non ACM	-	-	-	-	
Original Building	Doors	Exterior Frames	Silicon Sealant		-	Non ACM	-	-	-	-	
Original Building	Mastic	Mastic	Floor Tile Mastic		NF	ACM	HM	32523-WOHS S68	10-Mar-08	3.5% Chrysotile	
1958 Addition	Structure	Deck	Concrete		-	Non ACM	-	-	-	-	
1958 Addition	Structure	Concrete	Concrete		-	Non ACM	-	-	-	-	
1958 Addition	Façade	Brick Veneer	Brick and Mortar		-	Non ACM	-	-	-	-	
1958 Addition	Not Inspected	Not Inspected	Roofing Materials		NF	Suspect ACM	VC	-	-	-	
1958 Addition	Windows	Interior/Exterior Frames	Silicon Sealant		-	Non ACM	-	-	-	-	
1958 Addition	Doors	Exterior Frames	Silicon Sealant		-	Non ACM	-	-	-	-	
1958 Addition	Mastic	Mastic	Floor Tile Mastic		NF	ACM	HM	32523-WOHS S28	10-Mar-08	1.9% Chrysotile	
1962 Addition	Structure	Deck	Steel		-	Non ACM	-	-	-	-	
1962 Addition	Structure	Concrete	Concrete		-	Non ACM	-	-	-	-	
1962 Addition	Façade	Brick Veneer	Brick and Mortar		-	Non ACM	-	-	-	-	
1962 Addition	Not Inspected	Not Inspected	Roofing Materials		NF	Suspect ACM	VC	-	-	-	
1962 Addition	Windows	Interior/Exterior Frames	Beige Sealant		NF	ACM	HM	S04	5-Jun-18	1% Chrysotile	
1962 Addition	Doors	Exterior Frames	Silicon Sealant		-	Non ACM	-	-	-	-	
1962 Addition	Mastic	Mastic	Floor Tile Mastic		-	Non ACM	-	32523-WOHS S15	10-Mar-08	ND	
1962 Addition	Ceiling	Ceiling Tile 1' x 1'	Brown Mastic		-	Non ACM	HM	S12	10-May-18	ND	
1966 Addition	Structure	Deck	Steel		-	Non ACM	-	-	-	-	
1966 Addition	Structure	Concrete	Concrete		-	Non ACM	-	-	-	-	
1966 Addition	Façade	Brick Veneer	Brick and Mortar		-	Non ACM	-	-	-	-	
1966 Addition	Not Inspected	Not Inspected	Roofing Materials		NF	Suspect ACM	VC	-	-	-	
1966 Addition	Windows	Interior/Exterior Frames	Beige Sealant		NF	ACM	HM	S05	5-Jun-18	5% Chrysotile	
1966 Addition	Doors	Exterior Frames	Silicon Sealant		-	Non ACM	-	-	-	-	
1966 Addition	Mastic	Mastic	Floor Tile Mastic		-	Non ACM	-	32523-WOHS S09	10-Mar-08	ND	



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
	1966 Addition	Ceiling	Ceiling Tile 1' x 1'	Brown Mastic		-	Non ACM	HM	S13	10-May-18	ND
	1971 Addition	Structure	Deck	Steel		-	Non ACM	-	-	-	-
	1971 Addition	Structure	Concrete	Concrete		-	Non ACM	-	-	-	-
	1971 Addition	Façade	Brick Veneer	Brick and Mortar		-	Non ACM	-	-	-	-
	1971 Addition	Not Inspected	Not Inspected	Roofing Materials		NF	Suspect ACM	VC	-	-	-
	1971 Addition	Windows	Interior/Exterior Frames	Silicon Sealant		-	Non ACM	-	-	-	-
	1971 Addition	Doors	Interior/Exterior Frames	Silicon Sealant		-	Non ACM	-	-	-	-
	1971 Addition	Mastic	Mastic	Floor Tile Mastic		NF	ACM	HM	32523-WOHS S32	10-Mar-08	3.3% Chrysotile
	1972 Addition	Structure	Deck	Steel		-	Non ACM	-	-	-	-
	1972 Addition	Structure	Concrete	Concrete		-	Non ACM	-	-	-	-
	1972 Addition	Façade	Brick Veneer	Brick and Mortar		-	Non ACM	-	-	-	-
	1972 Addition	Not Inspected	Not Inspected	Roofing Materials		NF	Suspect ACM	-	-	-	-
	1972 Addition	Windows	Interior/Exterior Frames	Beige Sealant		-	Non ACM	HM	S03	5-Jun-18	8% Chrysotile
	1972 Addition	Doors	Interior Frames	Beige Sealant		-	Non ACM	HM	S02	5-Jun-18	8% Chrysotile
	1972 Addition	Doors	Exterior Frames	Brown Sealant		-	Non ACM	HM	S01	5-Jun-18	ND
	1972 Addition	Mastic	Mastic	Floor Tile Mastic		NF	ACM	HM	32523-WOHS S88	10-Mar-08	0.75% Chrysotile

Level 1

101	Office	Floor	Vinyl Sheet Flooring	Grey Fleck (2021)		-	Non ACM	-	-	-	-
101	Office	Wall	Concrete	-		-	Non ACM	-	-	-	-
101	Office	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-	-	-	-
101	Office	Firespray	Firespray	Colour Sprayed Applied (2021)		-	Non ACM	-	-	-	-
102	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	SL	S07ABC	13-Mar-08	ND
102	Classroom	Wall	Wood	-		-	Non ACM	-	-	-	-
102	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
102	Classroom	Wall	Cork Board	-		-	Non ACM	-	-	-	-
102	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-	-	-	-
102	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)		-	Non ACM	-	-	-	-
102A	Lunchroom	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	SL	S07ABC	13-Mar-08	ND
102A	Lunchroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
102A	Lunchroom	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
102A	Lunchroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
102A	Lunchroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-		-	-
102A	Lunchroom	Firespray	Firespray	Sprayed Applied	F	ACM	HM	S06		13-Mar-08	4.1% Chrysotile
102B	Head CU	Floor	Carpet	-	-	Non ACM	-	-		-	-
102B	Head CU	Wall	Concrete	-	-	Non ACM	-	-		-	-
102B	Head CU	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
102B	Head CU	Firespray	Firespray	Sprayed Applied	F	ACM	HM	S06		13-Mar-08	4.1% Chrysotile
102C	Workroom	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck	-	Non ACM	SL	S07ABC		13-Mar-08	ND
102C	Workroom	Wall	Wood	-	-	Non ACM	-	-		-	-
102C	Workroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
102C	Workroom	Wall	Cork Board	-	-	Non ACM	-	-		-	-
102C	Workroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
102D	Washroom	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck	-	Non ACM	SL	S07ABC		13-Mar-08	ND
102D	Washroom	Wall	Wood	-	-	Non ACM	-	-		-	-
102D	Washroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
102D	Washroom	Wall	Cork Board	-	-	Non ACM	-	-		-	-
102D	Washroom	Ceiling	Plaster	-	-	Non ACM	HM	S72, S82		13-Mar-08	ND
103	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Grey with White	NF	ACM	HM	S18		10-Mar-08	1.8% Chrysotile
103	Classroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
103	Classroom	Ceiling	Metal Pan	-	-	Non ACM	-	-		-	-
103	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-		-	-
103A	Washroom	Floor	Vinyl Sheet Flooring	Grey Fleck (2021)	-	Non ACM	-	-		-	-
103A	Washroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
103A	Washroom	Wall	Drywall	Post 2010	-	Non ACM	-	-		-	-
103A	Washroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82		13-Mar-08	ND
103A	Washroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-		-	-
103A	Washroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-		-	-
103B	Washroom	Floor	Vinyl Sheet Flooring	Grey Fleck (2021)	-	Non ACM	-	-		-	-
103B	Washroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
103B	Washroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82		13-Mar-08	ND
103B	Washroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-		-	-
103B	Washroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-		-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
103C	Workroom	Floor	Vinyl Sheet Flooring	Laminate Pattern	-	Non ACM	-	-	-	-	-
103C	Workroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
103C	Workroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
103C	Workroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
103C	Workroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
103C	Workroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
103D	Workroom	Floor	Vinyl Sheet Flooring	Grey Fleck (2021)	-	Non ACM	-	-	-	-	-
103D	Workroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
103D	Workroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
103D	Workroom	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S81	10-Mar-08	1% Chrysotile	
103D	Workroom	Wall	Wood	-	-	Non ACM	HM	-	13-Mar-08	ND	
103D	Workroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
103D	Workroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
103E	Washroom	Floor	Vinyl Sheet Flooring	Grey Fleck (2021)	-	Non ACM	-	-	-	-	-
103E	Washroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
103E	Washroom	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile	
103E	Washroom	Ceiling	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
103E	Washroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
103E	Washroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
104	Classroom	Floor	Vinyl Sheet Flooring	Grey Fleck (2021)	-	Non ACM	-	-	-	-	-
104	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
104	Classroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
104	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
104	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
104A	Greenhouse	Floor	Concrete	-	-	Non ACM	-	-	-	-	-
104A	Greenhouse	Walls	Glass	-	-	Non ACM	-	-	-	-	-
104A	Greenhouse	Ceiling	Glass	-	-	Non ACM	-	-	-	-	-
104A	Greenhouse	Panels	Transite Panels at Seams	Transite	NF	ACM	VC	-	-	-	-
104B	Greenhouse	Floor	Concrete	-	-	Non ACM	-	-	-	-	-
104B	Greenhouse	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
104B	Greenhouse	Wall	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
104B	Greenhouse	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
104B	Greenhouse	Ceiling	Wood	-		-	Non ACM	-		-	-
104C	Storage	Floor	Vinyl Sheet Flooring	Grey Fleck (2021)		-	Non ACM	-		-	-
104C	Storage	Wall	Concrete	-		-	Non ACM	-		-	-
104C	Storage	Wall	Plywood	Wood		-	Non ACM	-		-	-
104C	Storage	Ceiling	Plaster	-		-	Non ACM	HM	S72, S82	13-Mar-08	ND
104C	Storage	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-		-	-
104C	Storage	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
104C	Storage	Firespray	Firespray	Colour Sprayed Applied (2021)		-	Non ACM	-		-	-
200A	Library	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	HM	S07ABC	13-Mar-08	ND
200A	Library	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
200A	Library	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2001)		-	Non ACM	-		-	-
200B	Library	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	HM	S07ABC	13-Mar-08	ND
200B	Library	Wall	Concrete	-		-	Non ACM	-		-	-
200B	Library	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
200B	Library	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2001)		-	Non ACM	-		-	-
200E	Library	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	HM	S07ABC	13-Mar-08	ND
200E	Library	Floor	Carpet	-		-	Non ACM	-		-	-
200E	Library	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
200E	Library	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
200E	Library	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2001)		-	Non ACM	-		-	-
200F	Library	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	HM	S07ABC	13-Mar-08	ND
200F	Library	Wall	Concrete	-		-	Non ACM	-		-	-
200F	Library	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
200F	Library	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
200F	Library	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2001)		-	Non ACM	-		-	-
201	Office	Floor	Vinyl Floor Tile 9"x 9"	Grey with Black		NF	ACM	SL	S89	13-Mar-08	2.4% Chrysotile
201	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
201	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
201A	Health	Floor	Vinyl Floor Tile 12"x 12"	Grey with Spots		-	Non ACM	SL	S91	10-May-18	ND
201A	Health	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	SL	S07ABC	13-Mar-08	ND
201A	Health	Wall	Concrete	-		-	Non ACM	-		-	-
201A	Health	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
201A	Health	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S81		10-Mar-08	1% Chrysotile
201A	Health	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01		10-May-18	ND
201B	Shower	Floor	Ceramic Tile	-	-	Non ACM	-	-		-	-
201B	Shower	Wall	Ceramic Tile	-	-	Non ACM	-	-		-	-
201B	Shower	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 2010)	-	Non ACM	-	-		-	-
202	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Taupe	NF	ACM	SL	S84abc		13-Mar-08	2.2% Chrysotile
202	Classroom	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S81		10-Mar-08	1% Chrysotile
202	Classroom	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82		13-Mar-08	ND
202	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)	-	Non ACM	-	-		-	-
202	Classroom	Ceiling	Ceiling Tile 1' x 1'	Wide Fissure Random Pinhole	-	Non ACM	SL	S83abc		13-Mar-08	NA
202A	Work Room	Floor	Vinyl Floor Tile 12"x 12"	Green	-	Non ACM	SL	S80b		13-Mar-08	ND
202A	Work Room	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S81		10-Mar-08	1% Chrysotile
202A	Work Room	Ceiling	Ceiling Tile 2' x 4'	Long Fissure Random Pinhole	-	Non ACM	SL	S85abc		13-Mar-08	ND
202A	Work Room	Ducting	Flex Joint	-	-	NF	ACM	VC	-	-	-
202A	Work Room	Ceiling	Ceiling Tile 1' x 1'	Wide Fissure Random Pinhole	-	Non ACM	HM	S08		10-May-18	ND
202B	Office	Floor	Vinyl Floor Tile 12"x 12"	Taupe	NF	ACM	SL	S84b		13-Mar-08	2.2% Chrysotile
202B	Office	Wall	Plaster	-	-	Non ACM	HM	S82		13-Mar-08	ND
202B	Office	Ceiling	Ceiling Tile 2' x 4'	Random Fissure, Random Pinhole	-	Non ACM	SL	S86abc		13-Mar-08	ND
203	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Green	-	Non ACM	HM	S80		13-Mar-08	ND
203	Classroom	Wall	Plaster	-	-	Non ACM	SL	S82ce		13-Mar-08	ND
203	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)	-	Non ACM	-	-		-	-
203	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole	-	Non ACM	HM	S77		13-Mar-08	NA
204	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Taupe	NF	ACM	HM	S84		13-Mar-08	2.2% Chrysotile
204	Classroom	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S81		10-Mar-08	1% Chrysotile
204	Classroom	Wall	Plaster	-	-	Non ACM	SL	S82b		13-Mar-08	ND
204	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01		10-May-18	ND
204	Classroom	Ceiling	Ceiling Tile 1' x 1'	Wide Fissure Random Pinhole	-	Non ACM	HM	S08		10-May-18	ND
205	Kitchen	Floor	Vinyl Floor Tile 12"x 12"	Green	-	Non ACM	HM	S80		13-Mar-08	ND
205	Kitchen	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S81		10-Mar-08	1% Chrysotile
205	Kitchen	Wall	Plaster	-	-	Non ACM	SL	S82ce		13-Mar-08	ND
205	Kitchen	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)	-	Non ACM	-	-		-	-
206	Work Room	Floor	Vinyl Floor Tile 12"x 12"	Green	-	Non ACM	SL	S80b		13-Mar-08	ND



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
206	Work Room	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
206	Work Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
206	Work Room	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	SL	S77b	13-Mar-08	ND
206A	Work Room	Floor	Vinyl Floor Tile 12"x 12"	Green		-	Non ACM	SL	S80b	13-Mar-08	ND
206A	Work Room	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
206A	Work Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
206A	Work Room	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	SL	S77b	13-Mar-08	ND
207	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Grey/Green		NF	ACM	SL	S88abc	13-Mar-08	2.7% Chrysotile
207	Classroom	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
207	Classroom	Wall	Plaster	-		-	Non ACM	SL	S82ce	13-Mar-08	ND
207	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)		-	Non ACM	-	-	-	-
207	Classroom	Above Ceiling	Ceiling Tile 1' x 1'	Craters with Dots		-	Non ACM	SL	S87abc	13-Mar-08	ND
207	Classroom	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-
207A	Office	Floor	Carpet	-		-	Non ACM	-	-	-	-
207A	Office	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
207A	Office	Ceiling	Ceiling Tile 1' x 1'	Wide Fissure Random Pinhole		-	Non ACM	SL	S08ABC	10-May-18	ND
207C	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Grey/Green		NF	ACM	SL	S88abc	13-Mar-08	2.7% Chrysotile
207C	Classroom	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
207C	Classroom	Wall	Plaster	-		-	Non ACM	SL	S82ce	13-Mar-08	ND
207C	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)		-	Non ACM	-	-	-	-
207C	Classroom	Above Ceiling	Ceiling Tile 1' x 1'	Craters with Dots		-	Non ACM	SL	S87abc	13-Mar-08	ND
207C	Classroom	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-
208	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Green		-	Non ACM	HM	S80	13-Mar-08	ND
208	Classroom	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
208	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
208	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	13-Mar-08	NA
208	Classroom	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-
210	Office	Floor	Vinyl Floor Tile 12"x 12"	Grey Oatmeal		-	Non ACM	HM	S90	13-Mar-08	ND
210	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210	Office	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
210	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (1997)		-	Non ACM	-	-	-	-
210	Office	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
210A	Office	Floor	Carpet	-		-	Non ACM	-		-	-
210A	Office	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
210A	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210A	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)		-	Non ACM	-		-	-
210B	Office	Floor	Carpet	-		-	Non ACM	-		-	-
210B	Office	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
210B	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210B	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)		-	Non ACM	-		-	-
210C	Office	Floor	Carpet	-		-	Non ACM	-		-	-
210C	Office	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
210C	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210C	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)		-	Non ACM	-		-	-
210D	Office	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck		NF	ACM	HM	S30	13-Mar-08	5.0% Chrysotile
210D	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210D	Office	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	13-Mar-08	ND
210E	Office	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck		NF	ACM	HM	S30	13-Mar-08	5.0% Chrysotile
210E	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210E	Office	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	13-Mar-08	ND
210F	Office	Floor	Vinyl Floor Tile 9"x 9"	Green with Faded Streak		NF	ACM	SL	S76abc	13-Mar-08	1.4% Chrysotile
210F	Office	Wall	Concrete	-		-	Non ACM	-		-	-
210F	Office	Ceiling	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210G	Office	Floor	Carpet	-		-	Non ACM	-		-	-
210G	Office	Wall	Wood Panel	-		-	Non ACM	-		-	-
210G	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210G	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)		-	Non ACM	-		-	-
210H	Office	Floor	Vinyl Floor Tile 9"x 9"	Taupe with Spots		NF	ACM	HM	S96abc	13-Mar-08	1.5% Chrysotile
210H	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210H	Office	Ceiling	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210I	Office	Floor	Carpet	-		-	Non ACM	-		-	-
210I	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
210I	Office	Ceiling	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
300	Mechanical	Floor	Concrete	-		-	Non ACM	-		-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
300	Mechanical	Wall	Concrete	-		-	Non ACM	-		-	-
300	Mechanical	Deck	Concrete	-		-	Non ACM	-		-	-
300	Mechanical	Piping	Pipe Insulation	Air Cell		F	ACM	HM	1680.894.04	11-Sep-90	>75% Amosite
300	Mechanical	Mechanical	Mechanical Insulation	Boiler Breaching		F	ACM	SL	1680.894.05	11-Sep-90	50-75% Chrysotile; 25-50% Amosite
300	Mechanical	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
300	Mechanical	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-		-	-
300A	Mechanical	Floor	Concrete	-		-	Non ACM	-		-	-
300A	Mechanical	Wall	Concrete	-		-	Non ACM	-		-	-
300A	Mechanical	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-		-	-
300A	Mechanical	Deck	Concrete	-		-	Non ACM	-		-	-
300A	Mechanical	Ducting	Flex Joint	-		NF	ACM	VC	-	-	-
300A	Mechanical	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
301	Office	Floor	Hardwood	-		-	Non ACM	-		-	-
301	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
301	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (1997)		-	Non ACM	VC	-	-	-
301	Office	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	13-Mar-08	ND
301C	Office	Floor	Hardwood	-		-	Non ACM	-		-	-
301C	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
301C	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (1997)		-	Non ACM	VC	-	-	-
301C	Office	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	13-Mar-08	ND
301D	Office	Floor	Hardwood	-		-	Non ACM	-		-	-
301D	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
301D	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (1997)		-	Non ACM	VC	-	-	-
301D	Office	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	13-Mar-08	ND
301E	Office	Floor	Hardwood	-		-	Non ACM	-		-	-
301E	Office	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
301E	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (1997)		-	Non ACM	VC	-	-	-
301E	Office	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	13-Mar-08	ND
302	Work Room	Floor	Vinyl Floor Tile 12"x 12"	Cream with Brown		NF	ACM	SL	S94abc	13-Mar-08	1.2% Chrysotile
302	Work Room	Wall	Plaster	-		-	Non ACM	SL	S82g	13-Mar-08	ND
302	Work Room	Ceiling	Ceiling Tile 2' x 2'	Random Fissure		-	Non ACM	SL	S93abc	13-Mar-08	ND
302	Work Room	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
304	Office	Floor	Vinyl Floor Tile 12"x 12"	Brown Oatmeal		NF	ACM	SL	S95abc	13-Mar-08	0.75% Chrysotile
304	Office	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
304	Office	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (2001)		-	Non ACM	VC	-	-	-
304	Office	Ducting	Duct Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-
304	Office	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-
305	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	SL	S07ABC	13-Mar-08	ND
305	Classroom	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
305	Classroom	Ceiling	Ceiling Tile 1' x 1'	Thick Fissure Pinhole		-	Non ACM	HM	S45	13-Mar-08	ND
305A	Office	Floor	Vinyl Sheet Flooring	Grey Dense Fleck (Post 2018)		-	Non ACM	-	-	-	-
305A	Office	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
305A	Office	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
305A	Office	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
305A	Office										
305A	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	-	-	-	-
305B	Storage	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck		NF	ACM	HM	S30	13-Mar-08	5.0% Chrysotile
305B	Storage	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
305B	Storage	Ceiling	Ceiling Tile 1' x 1'	Thick Fissure Pinhole		-	Non ACM	HM	S45	13-Mar-08	ND
305D	Washroom	Floor	Vinyl Sheet Flooring	Grey Dense Fleck (Post 2018)		-	Non ACM	-	-	-	-
305D	Washroom	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
305D	Washroom	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
305D	Washroom	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
305E	Kitchen	Floor	Vinyl Sheet Flooring	Grey Dense Fleck (Post 2018)		-	Non ACM	-	-	-	-
305E	Kitchen	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
305E	Kitchen	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
305E	Kitchen	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
305E	Kitchen	Ceiling	Ceiling Tile 2' x 2'	Thick Fissure Pinhole		-	Non ACM	HM	S06	10-May-18	ND
305F	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck		-	Non ACM	SL	S07ABC	13-Mar-08	ND
305F	Classroom	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
305F	Classroom	Ceiling	Ceiling Tile 1' x 1'	Thick Fissure Pinhole		-	Non ACM	HM	S45	13-Mar-08	ND
305G	Office	Floor	Vinyl Floor Tile 12"x 12"	Brown Oatmeal		NF	ACM	HM	S95	13-Mar-08	0.75% Chrysotile
305G	Office	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
305G	Office	Ceiling	Ceiling Tile 1' x 1'	Craters with Dots		-	Non ACM	SL	S87ac	13-Mar-08	ND



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
306	Classroom	Floor	Vinyl Floor Tile 12"x 12"	White with Black Fleck	-	-	Non ACM	SL	S42abc	13-Mar-08	ND
306	Classroom	Wall	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
306	Classroom	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (1997)	-	-	Non ACM	-	-	-	-
306	Classroom	Wall	Drywall	No Drywall Joint Compound	-	-	Non ACM	-	-	-	-
306	Classroom	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
307	Classroom	Floor	Vinyl Floor Tile 12"x 12"	White with Black Fleck	-	-	Non ACM	HM	S42	13-Mar-08	ND
307	Classroom	Wall	Plaster	-	-	-	Non ACM	SL	S43	13-Mar-08	ND
307	Classroom	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (1997)	-	-	Non ACM	-	-	-	-
307	Classroom	Wall	Drywall	No Drywall Joint Compound	-	-	Non ACM	-	-	-	-
307	Classroom	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
308A	Office	Floor	Hardwood	-	-	-	Non ACM	-	-	-	-
308A	Office	Wall	Drywall	-	-	-	Non ACM	-	-	-	-
308A	Office	Ceiling	Ceiling Tile 2'x2'	Dense Fissure Small Pinhole	-	-	Non ACM	HM	S29	13-Mar-08	ND
308	Office	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck	NF	ACM	HM	S30		13-Mar-08	5.0% Chrysotile
308	Office	Wall	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
308	Office	Ceiling	Drywall	No Drywall Joint Compound	-	-	Non ACM	-	-	-	-
308	Office	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Small Pinhole	-	-	Non ACM	HM	S29	13-Mar-08	ND
308	Office	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
309	Dressing Room	Floor	Vinyl Floor Tile 12"x 12"	Green with Black, White, & Grey Fleck	NF	ACM	SL	S34abc		13-Mar-08	2.2% Chrysotile
309	Dressing Room	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
309	Dressing Room	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)	-	-	Non ACM	-	-	-	-
309	Dressing Room	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
309A	Washroom	Floor	Vinyl Floor Tile 12"x 12"	Green with Black, White, & Grey Fleck	NF	ACM	SL	S34abc		13-Mar-08	2.2% Chrysotile
309A	Washroom	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
309A	Washroom	Ceiling	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
310	No Access	Not Inspected									
310A	No Access	Not Inspected									
311	Washroom	Floor	Vinyl Floor Tile 12"x 12"	Grey Dense Fleck (Post 2018)	-	-	Non ACM	-	-	-	-
311	Washroom	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
311	Washroom	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)	-	-	Non ACM	-	-	-	-
311	Washroom	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
312	Washroom	Floor	Vinyl Floor Tile 12"x 12"	Grey with Brown & White Fleck	-	-	Non ACM	SL	S37abc	13-Mar-08	ND



School Name Waterloo-Oxford District Secondary School Date Built: Original: 1955 Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	Legend:		Notes:	
	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.	
			F- Friable	
			Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.	

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
312	Washroom	Wall	Concrete	-		-	Non ACM	-		-	-
312	Washroom	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)		-	Non ACM	-		-	-
312	Washroom	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-		-	-
313	Storage	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck		NF	ACM	HM	S30	13-Mar-08	5.0% Chrysotile
313	Storage	Wall	Concrete	-		-	Non ACM	-		-	-
313	Storage	Ceiling	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
314	Storage	Floor	Vinyl Floor Tile 12"x 12"	Beige Dense Fleck (Post 2010)		-	Non ACM	-		-	-
314	Storage	Floor	Concrete	-		-	Non ACM	-		-	-
314	Storage	Wall	Concrete	-		-	Non ACM	-		-	-
314	Storage	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
314	Storage	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 2010)		-	Non ACM	-		-	-
314	Storage	Ceiling	Concrete	-		-	Non ACM	-		-	-
315	Storage to Washroom	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck		NF	ACM	HM	S30	13-Mar-08	5.0% Chrysotile
315	Storage to Washroom	Wall	Concrete	-		-	Non ACM	-		-	-
315	Storage to Washroom	Ceiling	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
315A	Washroom	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck		NF	ACM	HM	S30	13-Mar-08	5.0% Chrysotile
315A	Washroom	Wall	Concrete	-		-	Non ACM	-		-	-
315A	Washroom	Ceiling	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
315A	Washroom	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
316	Office	Floor	Vinyl Floor Tile 12"x 12"	Grey with Brown & White Fleck		-	Non ACM	HM	S37	13-Mar-08	ND
316	Office	Wall	Concrete	-		-	Non ACM	-		-	-
316	Office	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)		-	Non ACM	-		-	-
317	Kitchen/Dishwasher	Floor	Vinyl Floor Tile 12"x 12"	Grey with Brown & White Fleck		-	Non ACM	HM	S37	13-Mar-08	ND
317	Kitchen/Dishwasher	Wall	Concrete	-		-	Non ACM	-		-	-
317	Kitchen/Dishwasher	Ceiling	Ceiling Tile 2' x 2'	Solid Pattern		-	Non ACM	SL	S38abc	13-Mar-08	ND
317	Kitchen/Dishwasher	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (1994)		-	Non ACM	-		-	-
317	Kitchen/Dishwasher	Above Ceiling	Texture Coat	-		F	ACM	HM	S39	13-Mar-08	20% Chrysotile
318	Staff Dining	Floor	Vinyl Sheet Flooring	Grey Cloudy (Post 2018)		-	Non ACM	-		-	-
318	Staff Dining	Wall	Concrete	-		-	Non ACM	-		-	-
318	Staff Dining	Ceiling	Plaster	-		-	Non ACM	SL	S41abc	13-Mar-08	ND
318	Staff Dining	Above Ceiling	Texture Coat	-		F	ACM	HM	S39	13-Mar-08	20% Chrysotile
318	Staff Dining	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-		-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
319	Servery	Floor	Vinyl Floor Tile 12"x 12"	Grey with Brown & White Fleck	-	-	Non ACM	HM	S37	13-Mar-08	ND
319	Servery	Wall	Ceramic Tile	-	-	-	Non ACM	-	-	-	-
319	Servery	Ceiling	Ceiling Tile 2' x 2'	Solid Pattern	-	-	Non ACM	SL	S38abc	13-Mar-08	ND
319	Servery	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (1994)	-	-	Non ACM	-	-	-	-
319	Servery	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
320	Servery	Floor	Terrazzo	-	-	-	Non ACM	-	-	-	-
320	Servery	Wall	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
320	Servery	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)	-	-	Non ACM	-	-	-	-
321	Custodial Room	Floor	Terrazzo	-	-	-	Non ACM	-	-	-	-
321	Custodial Room	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
321	Custodial Room	Ceiling	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
323	Cafetorium	Floor	Vinyl Floor Tile 12"x 12"	Black with Specks (Post 2010)	-	-	Non ACM	-	-	-	-
323	Cafetorium	Floor	Vinyl Floor Tile 12"x 12"	Beige with Specks (Post 2010)	-	-	Non ACM	-	-	-	-
323	Cafetorium	Floor	Vinyl Floor Tile 12"x 12"	Grey with Specks (Post 2010)	-	-	Non ACM	-	-	-	-
323	Cafetorium	Floor	Vinyl Floor Tile 12"x 12"	Green with Specks (Post 2010)	-	-	Non ACM	-	-	-	-
323	Cafetorium	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
323	Cafetorium	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Small Pinhole	-	-	Non ACM	SL	S29abc	13-Mar-08	ND
323	Cafetorium	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
323A	Stage	Floor	Wood	-	-	-	Non ACM	-	-	-	-
323A	Stage	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
323A	Stage	Wall	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
323A	Stage	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03		11-Sep-90	50-75% Chrysotile
323A	Stage	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
323B	Stage	Floor	Concrete	-	-	-	Non ACM	-	-	-	-
323B	Stage	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
323B	Stage	Wall	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
323B	Stage	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03		11-Sep-90	50-75% Chrysotile
323B	Stage	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
400A	Washroom	Floor	Terrazzo	-	-	-	Non ACM	-	-	-	-
400A	Washroom	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
400A	Washroom	Wall	Ceramic Tile	-	-	-	Non ACM	-	-	-	-
400A	Washroom	Ceiling	Ceiling Tile 2' x 4'	Thick Fissure	-	-	Non ACM	SL	S65abc	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
400B	Office	Floor	Terrazzo	-		-	Non ACM	-		-	-
400B	Office	Wall	Concrete	-		-	Non ACM	-		-	-
400B	Office	Wall	Ceramic Tile	-		-	Non ACM	-		-	-
400B	Office	Ceiling	Ceiling Tile 2' x 4'	Textured Pinhole		-	Non ACM	SL	S10abc	10-May-18	ND
400B	Office	Ceiling	Ceiling Tile 1' x 1'	Large and Small		-	Non ACM	HM	S10	10-Mar-08	ND
400B	Office	Piping	Pipe Insulation	Fiberglass insulation		-	Non ACM	-		-	-
400D	Storage	Floor	Concrete	-		-	Non ACM	-		-	-
400D	Storage	Wall	Plaster	-		-	Non ACM	HM	S64	10-Mar-08	ND
400D	Storage	Ceiling	Plaster	-		-	Non ACM	HM	S64	10-Mar-08	ND
401	Gymnasium	Floor	Wood	-		-	Non ACM	-		-	-
401	Gymnasium	Wall	Concrete	-		-	Non ACM	-		-	-
401	Gymnasium	Ceiling	Metal Pan	-		-	Non ACM	-		-	-
401	Gymnasium	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
401A	Storage	Floor	Vinyl Floor Tile 12"x 12"	Grey Dense Fleck (Post 2010)		-	Non ACM	-		-	-
401A	Storage	Wall	Concrete	-		-	Non ACM	-		-	-
401A	Storage	Wall	Brick	-		-	Non ACM	-		-	-
401A	Storage	Ceiling	Wood	-		-	Non ACM	-		-	-
401A	Storage	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
401B	Office	Floor	Vinyl Floor Tile 12"x 12"	Grey Dense Fleck (Post 2010)		-	Non ACM	-		-	-
401B	Office	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
401B	Office	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
401C	Washroom	Floor	Vinyl Floor Tile 12"x 12"	Grey Dense Fleck (Post 2010)		-	Non ACM	-		-	-
401C	Washroom	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
401C	Washroom	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
401C	Washroom	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
401D	Football Storage Room	Floor	Concrete	-		-	Non ACM	-		-	-
401D	Football Storage Room	Wall	Concrete	-		-	Non ACM	-		-	-
401D	Football Storage Room	Ceiling	Concrete	-		-	Non ACM	-		-	-
401D	Football Storage Room	Piping	Pipe Fitting	Fiberglass/PVC		-	Non ACM	-		-	-
402	Gymnasium	Floor	Wood	-		-	Non ACM	-		-	-
402	Gymnasium	Wall	Concrete	-		-	Non ACM	-		-	-
402	Gymnasium	Ceiling	Metal Pan	-		-	Non ACM	-		-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
402	Gymnasium	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
402A	Weight Room	Floor	Rubber	-		-	Non ACM	-	-	-	-
402A	Weight Room	Floor	Concrete	-		-	Non ACM	-	-	-	-
402A	Weight Room	Wall	Concrete	-		-	Non ACM	-	-	-	-
402A	Weight Room	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile
402A	Weight Room	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile
402B	Gym Storage	Floor	Vinyl Floor Tile 12"x 12"	Blue with Blue and White Fleck		NF	ACM	-	-	-	-
402B	Gym Storage	Wall	Concrete	-		-	Non ACM	-	-	-	-
402B	Gym Storage	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile
402A	Gym Storage	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
402A	Gym Storage	Wall	Concrete	-		-	Non ACM	-	-	-	-
402A	Gym Storage	Wall	Plaster	-		-	Non ACM	SL	S64abc	10-Mar-08	ND
402A	Gym Storage	Wall	Plaster	-		-	Non ACM	HM	S64	10-Mar-08	ND
402B	Gym Storage	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
402B	Gym Storage	Wall	Concrete	-		-	Non ACM	-	-	-	-
402B	Gym Storage	Wall	Plaster	-		-	Non ACM	SL	S64abc	10-Mar-08	ND
402B	Gym Storage	Wall	Plaster	-		-	Non ACM	HM	S64	10-Mar-08	ND
402C	Gym Storage	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
402C	Gym Storage	Wall	Concrete	-		-	Non ACM	-	-	-	-
402C	Gym Storage	Wall	Plaster	-		-	Non ACM	SL	S64abc	10-Mar-08	ND
402C	Gym Storage	Wall	Plaster	-		-	Non ACM	HM	S64	10-Mar-08	ND
402C	Electrical Room	Not Inspected									
403	Gym	Floor	Hardwood	-		-	Non ACM	-	-	-	-
403	Gym	Wall	Concrete	-		-	Non ACM	-	-	-	-
403	Gym	Deck	Metal Pan	Steel		-	Non ACM	-	-	-	-
403	Gym	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
403A	Storage	Floor	Concrete	-		-	Non ACM	-	-	-	-
403A	Storage	Wall	Plaster	-		-	Non ACM	SL	S64abc	10-Mar-08	ND
403A	Storage	Wall	Plaster	-		-	Non ACM	HM	S64	10-Mar-08	ND
403B	Changeroom	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
403B	Changeroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
403B	Changeroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small		-	Non ACM	HM	S10	10-Mar-08	ND



School Name Waterloo-Oxford District Secondary School Date Built: Original: 1955 Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	Legend:		Notes:	
	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.	
			F- Friable	
			Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.	

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
403B	Changeroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Small Pinhole	-	Non ACM	SL	S01ABC	10-May-18	ND	
403B	Changeroom	Piping	Pipe Insulation	Fiberglass insulation	-	Non ACM	-	-	-	-	
403C	Changeroom	Floor	Ceramic Tile	-	-	Non ACM	-	-	-	-	
403C	Changeroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
403C	Changeroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small	-	Non ACM	HM	S10	10-Mar-08	ND	
403C	Changeroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Small Pinhole	-	Non ACM	SL	S01ABC	10-May-18	ND	
403C	Changeroom	Piping	Pipe Insulation	Fiberglass insulation	-	Non ACM	-	-	-	-	
403D	Changeroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
403D	Changeroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small	-	Non ACM	HM	S10	10-Mar-08	ND	
403D	Changeroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Small Pinhole	-	Non ACM	SL	S01ABC	10-May-18	ND	
403D	Changeroom	Piping	Pipe Insulation	Fiberglass insulation	-	Non ACM	-	-	-	-	
403E	Changeroom	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
403E	Changeroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
403E	Changeroom	Ceiling	Ceramic Tile	-	-	Non ACM	-	-	-	-	
403E	Changeroom	Piping	Pipe Insulation	Fiberglass insulation	-	Non ACM	-	-	-	-	
403F	Changeroom	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
403F	Changeroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
403F	Changeroom	Ceiling	Ceramic Tile	-	-	Non ACM	-	-	-	-	
403F	Changeroom	Piping	Pipe Insulation	Fiberglass insulation	-	Non ACM	-	-	-	-	
403G	Changeroom	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
403G	Changeroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
403G	Changeroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small	-	Non ACM	HM	S10	10-Mar-08	ND	
403G	Changeroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Small Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
403G	Changeroom	Piping	Pipe Insulation	Fiberglass insulation	-	Non ACM	-	-	-	-	
404	Music	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck	NF	ACM	SL	S26abc	13-Mar-08	0.75% Chrysotile	
404	Music	Floor	Vinyl Floor Tile 12"x 12"	Teal Dense Fleck	-	Non ACM	SL	S07	13-Mar-08	ND	
404	Music	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
404	Music	Wall	Concrete	-	-	Non ACM	-	-	-	-	
404	Music	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12	10-Mar-08	2.1% Amosite	
404	Music	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	
404	Music	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
404A	Practice Room	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck	NF	ACM	HM	S26	13-Mar-08	0.75% Chrysotile	



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
404A	Practice Room	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
404A	Practice Room	Wall	Concrete	-		-	Non ACM	-	-	-	-
404A	Practice Room	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
404A	Practice Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	-
404B	Practice Room	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck	NF	ACM	HM	S26		13-Mar-08	0.75% Chrysotile
404B	Practice Room	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
404B	Practice Room	Wall	Concrete	-		-	Non ACM	-	-	-	-
404B	Practice Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	-
404B	Practice Room	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
404C	Practice Room	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck	NF	ACM	HM	S26		13-Mar-08	0.75% Chrysotile
404C	Practice Room	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
404C	Practice Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	-
404C	Practice Room	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
404D	Practice Room	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck	NF	ACM	HM	S26		13-Mar-08	0.75% Chrysotile
404D	Practice Room	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
404D	Practice Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	-
404D	Practice Room	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
404E	Practice Room	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck	NF	ACM	HM	S26		13-Mar-08	0.75% Chrysotile
404E	Practice Room	Floor	Concrete	-		-	Non ACM	-	-	-	-
404E	Practice Room	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S07		10-Mar-08	1.8% Chrysotile
404E	Practice Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	-
404E	Practice Room	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
404F	Practice Room	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck	NF	ACM	HM	S26		13-Mar-08	0.75% Chrysotile
404F	Practice Room	Floor	Concrete	-		-	Non ACM	-	-	-	-
404F	Practice Room	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S07		10-Mar-08	1.8% Chrysotile
404F	Practice Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	-
404F	Practice Room	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
405	Classroom	Floor	Carpet	-		-	Non ACM	-	-	-	-
405	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Beige with Grey Fleck	-	Non ACM	SL	S25abc		13-Mar-08	Trace Chrysotile
405	Classroom	Wall	Plaster	-		-	Non ACM	HM	S24	13-Mar-08	ND
405	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
405	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
405	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
405	Classroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03		11-Sep-90	50-75% Chrysotile
405A	Workroom	Floor	Vinyl Floor Tile 9"x 9"	Beige with Grey Fleck	-	Non ACM	SL	S25abc		13-Mar-08	Trace Chrysotile
405A	Workroom	Floor	Floor Tile Mastic	Black Mastic	-	-	HM	S26		13-Mar-08	Non Detect
405A	Workroom	Floor	Concrete	-	-	-	-	-		-	-
405A	Workroom	Wall	Plaster	-	-	Non ACM	HM	S24		13-Mar-08	ND
405A	Workroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	-	-	-		-	-
405A	Workroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole	NF	ACM	HM	S12		10-Mar-08	2.1% Amosite
409	Changeroom	Floor	Terrazzo	-	-	Non ACM	-	-		-	-
409	Changeroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
409	Changeroom	Wall	Ceramic Tile	-	-	Non ACM	-	-		-	-
409	Changeroom	Ceiling	Concrete	-	-	Non ACM	-	-		-	-
409A	Changeroom	Floor	Terrazzo	-	-	Non ACM	-	-		-	-
409A	Changeroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
409A	Changeroom	Wall	Ceramic Tile	-	-	Non ACM	-	-		-	-
409A	Changeroom	Ceiling	Concrete	-	-	Non ACM	-	-		-	-
409B	Washroom	Floor	Terrazzo	-	-	Non ACM	-	-		-	-
409B	Washroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
409B	Washroom	Wall	Ceramic Tile	-	-	Non ACM	-	-		-	-
409B	Washroom	Ceiling	Concrete	-	-	Non ACM	-	-		-	-
410	Washroom	Floor	Terrazzo	-	-	Non ACM	-	-		-	-
410	Washroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
410	Washroom	Wall	Ceramic Tile	-	-	Non ACM	-	-		-	-
410	Washroom	Ceiling	Concrete	-	-	Non ACM	-	-		-	-
410A	Changeroom	Floor	Terrazzo	-	-	Non ACM	-	-		-	-
410A	Changeroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
410A	Changeroom	Wall	Ceramic Tile	-	-	Non ACM	-	-		-	-
410A	Changeroom	Ceiling	Concrete	-	-	Non ACM	-	-		-	-
410B	Changeroom	Floor	Terrazzo	-	-	Non ACM	-	-		-	-
410B	Changeroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
410B	Changeroom	Wall	Ceramic Tile	-	-	Non ACM	-	-		-	-
410B	Changeroom	Ceiling	Concrete	-	-	Non ACM	-	-		-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
410C	Tuck Shop	Floor	Vinyl Floor Tile 9"x 9"	Grey with White Streaks	NF	ACM	SL	S68abc	10-Mar-08	1.3% Chrysotile	
410C	Tuck Shop	Wall	Plaster	-	-	Non ACM	HM	S82	13-Mar-08	ND	
410C	Tuck Shop	Ceiling	Ceiling Tile 1' x 1'	Large and Small	-	Non ACM	HM	S77	10-Mar-08	ND	
500	Washroom	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
500	Washroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
500	Washroom	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
500	Washroom	Ceiling	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
500	Washroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
500	Pipe Chase	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
500	Pipe Chase	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
500	Pipe Chase	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole	-	Non ACM	HM	S04, S77	13-Mar-08	ND	
500A	Washroom	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
500A	Washroom	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
500A	Washroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
500A	Washroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole	-	Non ACM	HM	S04, S77	13-Mar-08	ND	
500A	Washroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
501	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Tan with Red and Black	NF	ACM	SL	S28abc	13-Mar-08	4.1% Chrysotile	
501	Classroom	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
501	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole	-	Non ACM	HM	S04, S77	13-Mar-08	ND	
501	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	VC	-	-	-	
501	Classroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
502	Workroom	Floor	Vinyl Floor Tile 12"x 12"	White with Brown (Post 2010)	-	Non ACM	-	-	-	-	
502	Workroom	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
502	Workroom	Wall	Drywall	Post 2010	-	Non ACM	-	-	-	-	
502	Workroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole	-	Non ACM	HM	S04, S77	13-Mar-08	ND	
502	Workroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	
503	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Tan with Red and Black	NF	ACM	HM	S28	13-Mar-08	4.1% Chrysotile	
503	Classroom	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
503	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole	-	Non ACM	HM	S04, S77	13-Mar-08	ND	
503	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	VC	-	-	-	
503	Classroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
504	Workroom	Floor	Vinyl Floor Tile 12"x 12"	White with Brown (Post 2010)	-	Non ACM	-	-	-	-	



School Name Waterloo-Oxford District Secondary School Date Built: Original: 1955 Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011		Legend:						Notes:			
		HM - Homogenous Material - homogeneous with previously sampled material						All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.			
		SL - Sample Location - Material Sampled									
		VC - Visually Confirmed - Material not sampled, deemed ACM									
		NF - Non-Friable						F- Friable			
Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.											
WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
504	Workroom	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
504	Workroom	Wall	Drywall	Post 2010		-	Non ACM	-	-	-	-
504	Workroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S04, S77	13-Mar-08	ND
504	Workroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)		-	Non ACM	-	-	-	-
504A	Storage	Floor	Vinyl Floor Tile 12"x 12"	White with Brown (Post 2010)		-	Non ACM	-	-	-	-
504A	Storage	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
504A	Storage	Wall	Wood	-		-	Non ACM	-	-	-	-
504A	Storage	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S04, S77	13-Mar-08	ND
504B	Workroom	Floor	Vinyl Floor Tile 12"x 12"	White with Brown (Post 2010)		-	Non ACM	-	-	-	-
504B	Workroom	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
504B	Workroom	Wall	Drywall	Post 2010		-	Non ACM	-	-	-	-
504B	Workroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S04, S77	13-Mar-08	ND
504B	Workroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)		-	Non ACM	-	-	-	-
505	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Green with White Streaks		NF	ACM	HM	S21	13-Mar-08	0.5% Chrysotile
505	Classroom	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
505	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S04, S77	13-Mar-08	ND
505	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)		-	Non ACM	-	-	-	-
505	Classroom	Deck	Metal Pan	Steel		-	Non ACM	-	-	-	-
505	Classroom	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
506	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Blue with White Streaks		-	Non ACM	SL	S20abc	10-Mar-08	0.5% Chrysotile
506	Classroom	Wall	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	-
506	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
507	Classroom	Floor	Vinyl Sheet Flooring	Blue Dense Fleck (Post 2018)		-	Non ACM	-	-	-	-
507	Classroom	Wall	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	-
507	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
508	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Brown Oatmeal (Post 2010)		-	Non ACM	-	-	-	-
508	Classroom	Wall	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	-
508	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
508	Classroom	Ceiling	Ceiling Tile 1' x 1'	Pattern/Date		-	Non ACM	-	-	-	-
508	Classroom	Wall	Metal Partition	-		-	Non ACM	-	-	-	-
509	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Brown Oatmeal (Post 2010)		-	Non ACM	-	-	-	-
509	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
509	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01		10-May-18	ND
509A	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Brown Oatmeal (Post 2010)	-	Non ACM	-	-		-	-
509A	Classroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
509A	Classroom	Wall	Drywall	Drywall Joint Compound (Post 2000)	-	Non ACM	-	-		-	-
509A	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01		10-May-18	ND
509B	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Brown Oatmeal (Post 2010)	-	Non ACM	-	-		-	-
509B	Classroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
509B	Classroom	Wall	Drywall	Drywall Joint Compound (Post 2010)	-	Non ACM	-	-		-	-
509B	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01		10-May-18	ND
510	Classroom	Floor	Concrete	-	-	Non ACM	-	-		-	-
510	Classroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
510	Classroom	Wall	Plaster	-	-	Non ACM	SL	S03BC		10-May-18	ND
510	Classroom	Wall	Metal Partition	-	-	Non ACM	-	-		-	-
510	Classroom	Ceiling	Ceiling Tie	Fibreglass	-	Non ACM	-	-		-	-
510	Classroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03		11-Sep-90	50-75% Chrysotile
510	Classroom	Ducting	Flex Joint	-	-	NF	ACM	VC	-	-	-
510A	Classroom	Floor	Concrete	-	-	Non ACM	-	-		-	-
510A	Classroom	Wall	Concrete	-	-	Non ACM	-	-		-	-
510A	Classroom	Wall	Metal Partition	-	-	Non ACM	-	-		-	-
510A	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01		10-May-18	ND
510A	Classroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03		11-Sep-90	50-75% Chrysotile
511	Storage Room	Floor	Concrete	-	-	Non ACM	-	-		-	-
511	Storage Room	Wall	Plaster	-	-	Non ACM	HM	S02, S05, S19		10-Mar-08	ND
511	Storage Room	Wall	Concrete	-	-	Non ACM	-	-		-	-
511	Storage Room	Ceiling	Plaster	-	-	Non ACM	HM	S02, S05, S19		10-Mar-08	ND
511A	Cyclone Room	Floor	Concrete	-	-	Non ACM	-	-		-	-
511A	Cyclone Room	Wall	Concrete	-	-	Non ACM	-	-		-	-
511A	Cyclone Room	Ceiling	Metal Pan	Open Web Steel Joists	-	Non ACM	-	-		-	-
511B	Cyclone Room	Floor	Concrete	-	-	Non ACM	-	-		-	-
511B	Cyclone Room	Wall	Concrete	-	-	Non ACM	-	-		-	-
511B	Cyclone Room	Ceiling	Metal Pan	Open Web Steel Joists	-	Non ACM	-	-		-	-
511B	Cyclone Room	Mechanical	Cyclone	-	-	Non ACM	-	-		-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
511C	Fan Room	Floor	Concrete	-		-	Non ACM	-		-	-
511C	Fan Room	Wall	Concrete	-		-	Non ACM	-		-	-
511C	Fan Room	Wall	Brick	-		-	Non ACM	-		-	-
511C	Fan Room	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile
511C	Fan Room	Ducting	Flex Joint	-		NF	ACM	VC	-	-	-
511D	Stairwell	Floor	Vinyl Floor Tile 12"x 12"	Brown Oatmeal (Post 2010)		-	Non ACM	-		-	-
511D	Stairwell	Wall	Concrete	-		-	Non ACM	-		-	-
511D	Stairwell	Piping	Pipe Insulation	Fiberglass insulation		-	Non ACM	-		-	-
511D	Stairwell	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
511E	Stairwell	Floor	Vinyl Floor Tile 12"x 12"	Brown Oatmeal (Post 2010)		-	Non ACM	-		-	-
511E	Stairwell	Wall	Concrete	-		-	Non ACM	-		-	-
511E	Stairwell	Piping	Pipe Insulation	Fiberglass insulation		-	Non ACM	-		-	-
512	Classroom	Floor	Wood	-		-	Non ACM	-		-	-
512	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Grey with White		NF	ACM	SL	S18abc	10-Mar-08	1.8% Chrysotile
512	Classroom	Wall	Concrete	-		-	Non ACM	-		-	-
512	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
512	Classroom	Ceiling	Ceiling Tile 2' x 4'	Long Fissure Random Pinhole		-	Non ACM	-		-	-
512	Classroom	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
512B	Small Storage	Floor	Wood	-		-	Non ACM	-		-	-
512B	Small Storage	Wall	Plaster	-		-	Non ACM	SL	S03A	10-May-18	ND
512B	Small Storage	Ceiling	Ceiling Tile 1' x 1'	Cellulose		-	Non ACM	-		-	-
512C	Large Storage	Floor	Wood	-		-	Non ACM	-		-	-
512C	Large Storage	Wall	Plaster	-		-	Non ACM	HM	S03	10-May-18	ND
512C	Large Storage	Ceiling	Ceiling Tile 1' x 1'	Large Pinhole		-	Non ACM	HM	S10	10-May-18	ND
513	Media Room	Floor	Carpet	-		-	Non ACM	-		-	-
513	Media Room	Wall	Concrete	-		-	Non ACM	-		-	-
513	Media Room	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile
513	Media Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
513	Media Room	Piping	Pipe Fitting	Fiberglass/PVC		-	Non ACM	-		-	-
513A	Staff Room	Floor	Vinyl Floor Tile 12"x 12"	Tan with Brown		NF	ACM	SL	S15abc	10-Mar-08	3.6% Chrysotile
513A	Staff Room	Wall	Concrete	-		-	Non ACM	-		-	-
513A	Staff Room	Wall	Wood Panel	-		-	Non ACM	-		-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
513A	Staff Room	Ceiling	Ceiling Tile 2' x 4'	Medium Fissure Random Pinhole	-	Non ACM	HM	S02ABC	10-May-18	ND	
513A	Staff Room	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
513B	Staff Room	Floor	Vinyl Floor Tile 12"x 12"	Brown Dense Fleck (Post 2010)	-	Non ACM	-	-	-	-	
513B	Staff Room	Wall	Concrete	-	-	Non ACM	-	-	-	-	
513B	Staff Room	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole	-	Non ACM	HM	S04, S77	13-Mar-08	ND	
513B	Staff Room	Piping	Pipe Insulation	Horsehair	-	Non ACM	-	-	-	-	
513B	Staff Room	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
513C	Closet	Floor	Vinyl Floor Tile 12"x 12"	White with Grey Fleck (Post 2010)	-	Non ACM	-	-	-	-	
513C	Closet	Wall	Concrete	-	-	Non ACM	-	-	-	-	
513C	Closet	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
513C	Closet	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
513E	Storage Room	Floor	Vinyl Floor Tile 12"x 12"	White with Grey Fleck (Post 2010)	-	Non ACM	-	-	-	-	
513E	Storage Room	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile	
513E	Storage Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
513E	Storage Room	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
514	Classroom	Floor	Wood	-	-	Non ACM	-	-	-	-	
514	Classroom	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile	
514	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
514	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissures and Pinholes	-	Non ACM	SL	S13abc	10-Mar-08	ND	
514	Classroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
514A	Classroom	Floor	Carpet	-	-	Non ACM	-	-	-	-	
514A	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
514A	Classroom	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile	
514A	Classroom	Wall	Ceiling Tile 1' x 1'	Acoustic Tiles	-	Non ACM	SL	S14abc	10-Mar-08	ND	
514A	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
514A	Classroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
514B	Storage Room	Floor	Carpet	-	-	Non ACM	-	-	-	-	
514B	Storage Room	Wall	Concrete	-	-	Non ACM	-	-	-	-	
514B	Storage Room	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile	
514B	Storage Room	Wall	Ceiling Tile 1' x 1'	Acoustic Tiles	-	Non ACM	HM	S14abc	10-Mar-08	ND	
514B	Storage Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
514E	Closet	Floor	Concrete	-	-	Non ACM	-	-	-	-	



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
514E	Closet	Wall	Drywall	Post 2010		-	Non ACM	-		-	-
514E	Closet	Ceiling	Metal Pan	Open Web Steel Joists		-	Non ACM	-		-	-
515	Classroom	Floor	Concrete	-		-	Non ACM	-		-	-
515	Classroom	Wall	Plaster	-		-	Non ACM	HM	S24, S43	10-Mar-08	ND
515	Classroom	Wall	Concrete	-		-	Non ACM	-		-	-
515	Classroom	Ceiling	Metal Pan	Open Web Steel Joists		-	Non ACM	-		-	-
515A	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Brown with White Flecks		NF	ACM	HM	S09abc	10-Mar-08	1.3% Chrysotile
515A	Classroom	Wall	Plaster	-		-	Non ACM	HM	S24, S43	10-Mar-08	ND
515A	Classroom	Ceiling	Plaster	-		-	Non ACM	HM	S24, S43	10-Mar-08	ND
515B	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Brown with White Flecks		NF	ACM	SL	S09abc	10-Mar-08	1.3% Chrysotile
515B	Classroom	Wall	Plaster	-		-	Non ACM	HM	S24, S43	10-Mar-08	ND
515B	Classroom	Ceiling	Plaster	-		-	Non ACM	HM	S24, S43	10-Mar-08	ND
515B	Classroom	Floor	Concrete	-		-	Non ACM	-	-	-	-
515B	Classroom	Wall	Plaster	-		-	Non ACM	HM	S24, S43	10-Mar-08	ND
515B	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
515B	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large Pinhole		-	Non ACM	SL	S10abc	-	ND
515B	Classroom	Ceiling	Ceiling Tile 1' x 1'	Long Fissure Small Pinhole		-	Non ACM	SL	S11abc	-	ND
515B	Classroom	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
516	Classroom	Floor	Wood	-		-	Non ACM	-	-	-	-
516	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck		NF	ACM	SL	S26abc	13-Mar-08	0.75% Chrysotile
516	Classroom	Wall	Drywall	Drywall Joint Compound		NF	ACM	SL	S07abc	10-Mar-08	1.8% Chrysotile
516	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
516	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole		NF	ACM	SL	S12abc	10-Mar-08	2.1% Amosite
516	Classroom	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
516	Classroom	Piping	Pipe Insulation	Horsehair		-	Non ACM	-	-	-	-
516A	Small Store Room	Floor	Wood	-		-	Non ACM	-	-	-	-
516A	Small Store Room	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
516A	Small Store Room	Ceiling	Ceiling Tile 2' x 2'	Large Pinhole (Drywall)		-	Non ACM	-	-	-	-
516A	Small Store Room	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
516B	Large Store Room	Floor	Wood	-		-	Non ACM	-	-	-	-
516B	Large Store Room	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S07	10-Mar-08	1.8% Chrysotile
516B	Large Store Room	Wall	Concrete	-		-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
516B	Large Store Room	Ceiling	Ceiling Tile 2' x 2'	Large Pinhole (Drywall)	-	-	Non ACM	-	-	-	-
516C	Store Room	Floor	Wood	-	-	-	Non ACM	-	-	-	-
516C	Store Room	Wall	Drywall	Drywall Joint Compound	NF	ACM	SL	S07abc	10-Mar-08	1.8% Chrysotile	
516C	Store Room	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
516C	Store Room	Ceiling	Ceiling Tile 2' x 2'	Large Pinhole (Drywall)	-	-	Non ACM	-	-	-	-
517	Classroom	Floor	Concrete	-	-	-	Non ACM	-	-	-	-
517	Classroom	Floor	Wood	-	-	-	Non ACM	-	-	-	-
517	Classroom	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
517	Classroom	Wall	Brick	-	-	-	Non ACM	-	-	-	-
517	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 2010)	-	-	Non ACM	-	-	-	-
517	Classroom	Piping	Pipe Fitting	Fiberglass/PVC	-	-	Non ACM	-	-	-	-
517	Classroom	Piping	Pipe Fitting	Cellulose	-	-	Non ACM	-	-	-	-
517A	Classroom	Floor	Concrete	-	-	-	Non ACM	-	-	-	-
517A	Classroom	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
517A	Classroom	Ceiling	Concrete	-	-	-	Non ACM	-	-	-	-
518	Classroom	Floor	Concrete	-	-	-	Non ACM	-	-	-	-
518	Classroom	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
518	Classroom	Wall	Drywall	Drywall Joint Compound	-	-	Non ACM	SL	S01abc	10-Mar-08	ND
518	Classroom	Wall	Brick	-	-	-	Non ACM	-	-	-	-
518	Classroom	Ceiling	Ceiling Tile 2' x 4'	Long Fissure Random Pinhole	NF	ACM	SL	S03abc	10-Mar-08	1.7% Amosite, 0.6% Chrysotile	
518	Classroom	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
518A	Instrument Room	Floor	Concrete	-	-	-	Non ACM	-	-	-	-
518A	Instrument Room	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
518A	Instrument Room	Ceiling	Ceiling Tile 2' x 4'	Long Fissure Random Pinhole	NF	ACM	SL	S03abc	10-Mar-08	1.7% Amosite, 0.6% Chrysotile	
518A	Instrument Room	Ceiling	Concrete	-	-	-	Non ACM	-	-	-	-
518B	Storage Room	Floor	Concrete	-	-	-	Non ACM	-	-	-	-
518B	Storage Room	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
518B	Storage Room	Ceiling	Ceiling Tile 2' x 4'	Long Fissure Random Pinhole	NF	ACM	SL	S03abc	10-Mar-08	1.7% Amosite, 0.6% Chrysotile	
518B	Storage Room	Ceiling	Concrete	-	-	-	Non ACM	-	-	-	-
518B	Storage Room	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
518B	Storage Room	Piping	Pipe Insulation	Air Cell	F	ACM	HM	1680.894.04	11-Sep-90	>75% Amosite	
518C	Fan Room	Floor	Concrete	-	-	-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
518C	Fan Room	Wall	Concrete	-		-	Non ACM	-		-	-
518C	Fan Room	Ceiling	Concrete	-		-	Non ACM	-		-	-
518C	Fan Room	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
518C	Fan Room	Piping	Pipe Insulation	Air Cell		F	ACM	HM	1680.894.04	11-Sep-90	>75% Amosite
518C	Fan Room	Ducting	Flex Joint	-		NF	ACM	VC	-	-	-
801	Corridor - 1966	Floor	Terrazzo	-		-	Non ACM	-		-	-
801	Corridor - 1966	Wall	Plaster	-		-	Non ACM	SL	S72abc	13-Mar-08	ND
801	Corridor - 1966	Ceiling	Ceiling Tile 2' x 2'	Large and Small Pinhole (Drywall)		-	Non ACM	-		-	-
801	Corridor - 1966	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
801	Corridor - 1966	Piping	Pipe Insulation	Fiberglass insulation		-	Non ACM	-		-	-
801	Corridor - 1966	Piping	Pipe Fitting	Parged Cement		F	ACM	SL	1680.894.03	11-Sep-90	50-75% Chrysotile
801	Corridor - 1966	Firespray	Firespray	Spray-applied		F	ACM	SL	S71abc	13-Mar-08	3.8% Chrysotile
802	Corridor - 1955	Floor	Terrazzo	-		-	Non ACM	-		-	-
802	Corridor - 1955	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
802	Corridor - 1955	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (1991)		-	Non ACM	-		-	-
802	Corridor - 1955	Piping	Pipe Insulation	Fiberglass insulation		-	Non ACM	-		-	-
802	Corridor - 1955	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	13-Mar-08	ND
802	Corridor - 1955	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
802	Corridor - 1955	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
802	Corridor - 1955	Piping	Pipe Insulation	Air Cell		F	ACM	HM	1680.894.04	11-Sep-90	>75% Amosite
803	Corridor - 1955	Floor	Terrazzo	-		-	Non ACM	-		-	-
803	Corridor - 1955	Wall	Plaster	-		-	Non ACM	SL	S82b	13-Mar-08	ND
803	Corridor - 1955	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole		-	Non ACM	SL	S92abc	13-Mar-08	ND
803	Corridor - 1955	Piping	Pipe Insulation	Air Cell		F	ACM	HM	1680.894.04	11-Sep-90	>75% Amosite
803	Corridor - 1955	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
804	Corridor - 1955	Floor	Terrazzo	-		-	Non ACM	-		-	-
804	Corridor - 1955	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
804	Corridor - 1955	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)		-	Non ACM	-		-	-
804	Corridor - 1955	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
804A	Corridor - 1955	Floor	Terrazzo	-		-	Non ACM	-		-	-
804A	Corridor - 1955	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
804A	Corridor - 1955	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2004)		-	Non ACM	-		-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
805	Corridor - 1955	Floor	Vinyl Floor Tile 12"x 12"	Grey with Brown & White Fleck	-	-	Non ACM	HM	S37	13-Mar-08	ND
805	Corridor - 1955	Wall	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
805	Corridor - 1955	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Small Pinhole	-	-	Non ACM	HM	S29	13-Mar-08	ND
805	Corridor - 1955	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
807	Corridor - 1971	Floor	Terrazzo	-	-	-	Non ACM	-	-	-	-
807	Corridor - 1971	Wall	Plaster	-	-	-	Non ACM	SL	S35e	13-Mar-08	ND
807	Corridor - 1971	Ceiling	Ceiling Tile 2' x 2'	Large & Small Pinhole (Drywall)	-	-	Non ACM	-	-	-	-
807	Corridor - 1971	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Small Pinhole	-	-	Non ACM	SL	S29abc	13-Mar-08	ND
807	Corridor - 1971	Ducting	Duct Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
807	Corridor - 1971	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
807A	Corridor	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck	NF	ACM	HM	S30		13-Mar-08	5.0% Chrysotile
807A	Corridor	Wall	Plaster	-	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
807A	Corridor	Ceiling	Drywall	No Drywall Joint Compound	-	-	Non ACM	-	-	-	-
807A	Corridor	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Small Pinhole	-	-	Non ACM	HM	S29	13-Mar-08	ND
807A	Corridor	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
807B	Stage Entrance/Hallway	Floor	Vinyl Floor Tile 9"x 9"	Orange with White Fleck	NF	ACM	HM	S30		13-Mar-08	5.0% Chrysotile
807B	Stage Entrance/Hallway	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
807B	Stage Entrance/Hallway	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)	-	-	Non ACM	-	-	-	-
807B	Stage Entrance/Hallway	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
807C	Stage Entrance/Hallway	Floor	Vinyl Floor Tile 9"x 9"	Orange with White Fleck	NF	ACM	HM	S30		13-Mar-08	5.0% Chrysotile
807C	Stage Entrance/Hallway	Wall	Concrete	-	-	-	Non ACM	-	-	-	-
807C	Stage Entrance/Hallway	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)	-	-	Non ACM	-	-	-	-
807C	Stage Entrance/Hallway	Piping	Pipe Insulation	Fibreglass insulation	-	-	Non ACM	-	-	-	-
808	Corridor - 1955	Floor	Terrazzo	-	-	-	Non ACM	-	-	-	-
808	Corridor - 1955	Wall	Plaster	-	-	-	Non ACM	HM	S82	13-Mar-08	ND
808	Corridor - 1955	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole	-	-	Non ACM	HM	S01	10-May-18	ND
808	Corridor - 1955	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03		11-Sep-90	50-75% Chrysotile
809	Corridor - 1962	Floor	Vinyl Floor Tile 12"x 12"	Green with Grey and White	-	-	Non ACM	SL	S67abc	-	-
809	Corridor - 1962	Floor	Vinyl Floor Tile 12"x 12"	Black with Grey and White	-	-	Non ACM	SL	S66abc	-	-
809	Corridor - 1962	Floor	Vinyl Floor Tile 12"x 12"	Brown with Brown and White Fleck	-	-	Non ACM	HM	S53	13-Mar-08	ND
809	Corridor - 1962	Wall	Plaster	-	-	-	Non ACM	SL	S64de	10-Mar-08	ND
809	Corridor - 1962	Ceiling	Ceiling Tile 2' x 2'	Large Pinhole (Drywall)	-	-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
809	Corridor - 1962	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Random Pinhole	NF	ACM	SL	S05ABC	10-May-18	5% Amosite	
809	Corridor - 1962	Ceiling	Ceiling Tile 2' x 2'	Medium Fissure Pinhole	-	Non ACM	SL	S06ABC	10-May-18	ND	
809	Corridor - 1962	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
810	Corridor - 1958	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
810	Corridor - 1958	Wall	Plaster	-	-	Non ACM	SL	S27abcd	13-Mar-08	ND	
810	Corridor - 1958	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)	-	Non ACM	-	-	-	-	
810	Corridor - 1958	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	
810	Corridor - 1958	Piping	Pipe Insulation	Fibreglass insulation	-	Non ACM	-	-	-	-	
810	Corridor - 1958	Firespray	Firespray	Troweled-applied	F	ACM	HM	S23	13-Mar-08	3.2% Chrysotile	
811	Corridor - 1966	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
811	Corridor - 1966	Floor	Concrete	-	-	Non ACM	-	-	-	-	
811	Corridor - 1966	Wall	Plaster	-	-	Non ACM	SL	S24e	13-Mar-08	ND	
811	Corridor - 1966	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole (Drywall)	-	Non ACM	-	-	-	-	
811	Corridor - 1966	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	
811	Corridor - 1966	Firespray	Firespray	Troweled-applied	F	ACM	HM	S23	13-Mar-08	3.2% Chrysotile	
812	Corridor - 1962	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
812	Corridor - 1962	Wall	Plaster	-	-	Non ACM	HM	S24	13-Mar-08	ND	
812	Corridor - 1962	Ceiling	Ceiling Tile 2 x 2	Large & Small Pinhole	NF	ACM	-	-	-	-	
812	Corridor - 1962	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	
812	Corridor - 1962	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
812	Corridor - 1962	Firespray	Firespray	-	F	ACM	HM	S23	13-Mar-08	3.2% Chrysotile	
813	Corridor - 1972	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
813	Corridor - 1972	Wall	Plaster	-	-	Non ACM	SL	S02cde	-	ND	
813	Corridor - 1972	Ceiling	Ceiling Tile 2' x 2'	Large Pinhole (Drywall)	-	Non ACM	-	-	-	-	
813	Corridor - 1972	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole (2013)	-	Non ACM	-	-	-	-	
813	Corridor - 1972	Piping	Pipe Insulation	Fiberglass insulation	-	Non ACM	-	-	-	-	
813	Corridor - 1972	Firespray	Firespray	Spray-applied	F	ACM	HM	S06	10-Mar-08	4.1% Chrysotile	
813	Corridor - 1966	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	
813	Corridor - 1966	Wall	Plaster	-	-	Non ACM	SL	S05abcd	10-Mar-08	ND	
813	Corridor - 1966	Ceiling	Ceiling Tile 2' x 2'	Large Pinhole (Drywall)	-	Non ACM	-	-	-	-	
813	Corridor - 1966	Ceiling	Drywall	No Drywall Joint Compound	-	Non ACM	-	-	-	-	
813	Corridor - 1966	Firespray	Firespray	-	F	ACM	SL	S06abc	10-Mar-08	4.1% Chrysotile	



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
813	Corridor - 1966	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
813	Corridor - 1962	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
813	Corridor - 1962	Wall	Plaster	-		-	Non ACM	SL	S19abcde	10-Mar-08	ND
813	Corridor - 1962	Ceiling	Ceiling Tile 2' x 2'	Large Pinhole (Drywall)		-	Non ACM	-	-	-	-
813	Corridor - 1962	Ceiling	Drywall	No Drywall Joint Compound		-	Non ACM	-	-	-	-
813	Corridor - 1962	Firespray	Firespray	-		F	ACM	SL	S06abc	10-Mar-08	4.1% Chrysotile
813	Corridor - 1962	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
814	Corridor	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
814	Corridor	Wall	Concrete	-		-	Non ACM	-	-	-	-
814	Corridor	Wall	Ceramic Tile	-		-	Non ACM	-	-	-	-
814	Corridor	Ceiling	Ceiling Tile 1' x 1'	Large and Small		-	Non ACM	HM	S10	10-Mar-08	ND
814	Corridor	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
815	Corridor	Floor	Vinyl Floor Tile 9"x 9"	Tan with White & Black Fleck		NF	ACM	HM	S26	13-Mar-08	0.75% Chrysotile
815	Corridor	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
815	Corridor	Wall	Concrete	-		-	Non ACM	-	-	-	-
815	Corridor	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Pinhole		NF	ACM	HM	S12	10-Mar-08	2.1% Amosite
816	Corridor	Floor	Vinyl Floor Tile 12"x 12"	White with Grey Fleck (Post 2010)		-	Non ACM	-	-	-	-
816	Corridor	Wall	Concrete	-		-	Non ACM	-	-	-	-
816	Corridor	Wall	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
816	Corridor	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
818	Corridor	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck		NF	ACM	HM	S30	13-Mar-08	5.0% Chrysotile
818	Corridor	Wall	Concrete	-		-	Non ACM	-	-	-	-
818	Corridor	Ceiling	Plaster	-		-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND
818	Corridor	Piping	Pipe Insulation	Fiberglass insulation		-	Non ACM	-	-	-	-
818	Corridor	Above Ceiling	Texture Coat	-		F	ACM	HM	S39	13-Mar-08	20% Chrysotile
819	Corridor	Floor	Vinyl Floor Tile 12"x 12"	Grey with Brown & White Fleck		-	Non ACM	HM	S37	13-Mar-08	ND
819	Corridor	Wall	Concrete	-		-	Non ACM	-	-	-	-
819	Corridor	Ceiling	Ceiling Tile 2' x 2'	Solid Pattern		-	Non ACM	HM	S38	13-Mar-08	ND
819	Corridor	Piping	Pipe Insulation	Fiberglass insulation		-	Non ACM	-	-	-	-
820	Corridor	Floor	Concrete	-		-	Non ACM	-	-	-	-
820	Corridor	Wall	Concrete	-		-	Non ACM	-	-	-	-
820	Corridor	Wall	Brick	-		-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
820	Corridor	Deck	Concrete	-		-	Non ACM	-	-	-	-
820	Corridor	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
830	Corridor	Floor	Vinyl Floor Tile 12"x 12"	Grey Oatmeal		-	Non ACM	HM	S90	13-Mar-08	ND
830	Corridor	Wall	Plaster	-		-	Non ACM	HM	S64, S82	10-Mar-08	ND
830	Corridor	Wall	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
830	Corridor	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (1997)		-	Non ACM	-	-	-	-
830	Corridor	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-
901	Stairwell	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
901	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S72, S82	13-Mar-08	ND
901	Stairwell	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-	-	-	-
901	Stairwell	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
902	Stairwell	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
902	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S72, S82	13-Mar-08	ND
902	Stairwell	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-	-	-	-
902	Stairwell	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
903	Stairwell	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
903	Stairwell	Wall	Concrete	-		-	Non ACM	-	-	-	-
903	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
903	Stairwell	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
904	Stairwell	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
904	Stairwell	Wall	Concrete	-		-	Non ACM	-	-	-	-
904	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
904	Stairwell	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
905	Stairwell	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
905	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
905	Stairwell	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	10-May-18	ND
905	Stairwell	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
905	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
905	Stairwell	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S77	10-May-18	ND
905	Stairwell	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
905	Stairwell	Wall	Plaster	-		-	Non ACM	SL	S35abcd	13-Mar-08	ND
905	Stairwell	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Small Pinhole		-	Non ACM	SL	S29abc	13-Mar-08	ND



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
905	Stairwell	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (Post 1994)	-	Non ACM	-	-	-	-	-
905A	Stairwell	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	-
905A	Stairwell	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
905A	Stairwell	Wall	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
905A	Stairwell	Ceiling	Plaster	-	-	Non ACM	HM	S24, S72, S82	13-Mar-08	ND	
905A	Stairwell	Piping	Pipe Insulation	Fibreglass insulation	-	Non ACM	-	-	-	-	-
905A	Stairwell	Piping	Pipe Fitting	Fibreglass/PVC	-	Non ACM	-	-	-	-	-
906	Stairwell	Floor	Vinyl Floor Tile 12"x 12"	Orange with White Fleck	NF	ACM	SL	S30abc	13-Mar-08	5.0% Chrysotile	
906	Stairwell	Floor	Vinyl Floor Tile 12"x 12"	Beige with Grey Fleck	NF	ACM	SL	S31abc	13-Mar-08	5.0% Chrysotile	
906	Stairwell	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
906	Stairwell	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Small Pinhole	-	Non ACM	SL	S29abc	13-Mar-08	ND	
906	Stairwell	Piping	Pipe Insulation	Fibreglass insulation	-	Non ACM	-	-	-	-	-
907	Stairwell	Floor	Concrete	-	-	Non ACM	-	-	-	-	-
907	Stairwell	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
907	Stairwell	Ceiling	Concrete	-	-	Non ACM	-	-	-	-	-
908	Stairwell	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	-
908	Stairwell	Wall	Plaster	-	-	Non ACM	HM	S24, S43	10-Mar-08	ND	
908	Stairwell	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
908	Stairwell	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole	-	Non ACM	SL	S04abc	10-Mar-08	ND	
908	Stairwell	Ceiling	Plaster	-	-	Non ACM	HM	S24, S43	10-Mar-08	ND	
908A	Stairwell	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	-
908A	Stairwell	Wall	Plaster	-	-	Non ACM	HM	S24, S43	10-Mar-08	ND	
908A	Stairwell	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
908A	Stairwell	Ceiling	Plaster	-	-	Non ACM	HM	S24, S43	10-Mar-08	ND	
909	Stairwell	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	-
909	Stairwell	Wall	Plaster	-	-	Non ACM	HM	S02	10-Mar-08	ND	
909	Stairwell	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
909	Stairwell	Ceiling	Plaster	-	-	Non ACM	HM	S02	10-Mar-08	ND	
909	Stairwell	Ceiling	Ceiling Tile 2' x 2'	Large Pinhole (Drywall)	-	Non ACM	-	-	-	-	-
909	Stairwell	Floor	Terrazzo	-	-	Non ACM	-	-	-	-	-
909	Stairwell	Wall	Plaster	-	-	Non ACM	HM	S35	-	-	-
909	Stairwell	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
Level 2											
118	Washroom	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
118	Washroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
118	Washroom	Ceiling	Plaster	-		-	Non ACM	HM	S72	13-Mar-08	ND
118A	Custodial Room	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
118A	Custodial Room	Wall	Concrete	-		-	Non ACM	-	-	-	-
118A	Custodial Room	Ceiling	Plaster	-		-	Non ACM	HM	S72	13-Mar-08	ND
120	Washroom	Floor	Terrazzo	-		-	Non ACM	-	-	-	-
120	Washroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
120	Washroom	Ceiling	Plaster	-		-	Non ACM	HM	S72	13-Mar-08	ND
120A	Fan Room	Floor	Concrete	-		-	Non ACM	-	-	-	-
120A	Fan Room	Wall	Concrete	-		-	Non ACM	-	-	-	-
120A	Fan Room	Deck	Concrete	-		-	Non ACM	-	-	-	-
120A	Fan Room	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
120A	Fan Room	Ducting	Flex Joint	-		-	NF	ACM	VC	-	-
120A	Fan Room	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-	-	-	-
121	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Beige Dense Fleck (Post 2013)		-	Non ACM	-	-	-	-
121	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
121	Classroom	Wall	Plaster	-		-	Non ACM	HM	S72	13-Mar-08	ND
121	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-	-	-	-
121	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)		-	Non ACM	-	-	-	-
122	Classroom	Floor	Vinyl Sheet Flooring	New (2021)		-	Non ACM	-	-	-	-
122	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
122	Classroom	Wall	Plaster	-		-	Non ACM	HM	S72, S82	13-Mar-08	ND
122	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-	-	-	-
122	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)		-	Non ACM	-	-	-	-
123	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Olive with Black Streak		NF	ACM	SL	S11ABC	10-May-18	1% Chrysotile
123	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
123	Classroom	Wall	Plaster	-		-	Non ACM	HM	S72, S82	13-Mar-08	ND
123	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
123	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
124	Classroom	Floor	Vinyl Sheet Flooring	New (2021)	-	Non ACM	-	-	-	-	-
124	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
124	Classroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
124	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
124	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
125	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Green with Faded Streak	NF	ACM	SL	S76abc	13-Mar-08	1.4% Chrysotile	
125	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
125	Classroom	Wall	Plaster	-	-	Non ACM	SL	S72de	13-Mar-08	ND	
125	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
125	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
126	Classroom	Floor	Vinyl Sheet Flooring	New (2021)	-	Non ACM	-	-	-	-	-
126	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
126	Classroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
126	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
126	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
127	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Beige with Brown & White Fleck	NF	ACM	SL	S75abc	13-Mar-08	1.5% Chrysotile	
127	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
127	Classroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
127	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
127	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
128	Classroom	Floor	Vinyl Sheet Flooring	New (2021)	-	Non ACM	-	-	-	-	-
128	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
128	Classroom	Wall	Plaster	-	-	Non ACM	HM	S72, S82	13-Mar-08	ND	
128	Classroom	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)	-	Non ACM	-	-	-	-	-
128	Classroom	Firespray	Firespray	Colour Sprayed Applied (2021)	-	Non ACM	-	-	-	-	-
520	Washroom	Floor	Vinyl Floor Tile 12"x 12"	Beige with Beige Fleck	-	Non ACM	SL	S57abc	10-Mar-08	ND	
520	Washroom	Wall	Plaster	-	-	Non ACM	HM	S27	10-Mar-08	ND	
520	Washroom	Ceiling	Plaster	-	-	Non ACM	HM	S27	10-Mar-08	ND	
520A	Custodial Closet	Floor	Vinyl Floor Tile 12"x 12"	Grey with Grey and White Spots	-	Non ACM	SL	S58abc	10-Mar-08	ND	
520A	Custodial Closet	Wall	Plaster	-	-	Non ACM	HM	S27	10-Mar-08	ND	
520A	Custodial Closet	Wall	Wood	-	-	Non ACM	-	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
520A	Custodial Closet	Ceiling	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
521	Computer Room	Floor	Vinyl Floor Tile 9"x 9"	Green with White Streaks		NF	ACM	SL	S21abc	10-Mar-08	0.5% Chrysotile
521	Computer Room	Wall	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
521	Computer Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
521	Computer Room	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)		-	Non ACM	-	-	-	-
521A	Office	Floor	Vinyl Floor Tile 9"x 9"	Green with White Streaks		NF	ACM	HM	S21	10-Mar-08	0.5% Chrysotile
521A	Office	Wall	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
521A	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
521A	Office	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole		-	Non ACM	HM	S13	10-May-18	ND
522	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Blue with White Fleck		NF	ACM	HM	S20	10-Mar-08	0.5% Chrysotile
522	Classroom	Wall	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
522	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
522	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)		-	Non ACM	-	-	-	-
523	Computer Room	Floor	Vinyl Floor Tile 9"x 9"	Green with White Streaks		NF	ACM	HM	S21	10-Mar-08	0.5% Chrysotile
523	Computer Room	Wall	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
523	Computer Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
523	Computer Room	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)		-	Non ACM	-	-	-	-
524	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Olive/Green/Grey with White Streaks		NF	ACM	SL	S56abc	10-Mar-08	-
524	Classroom	Wall	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
524	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
524	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)		-	Non ACM	-	-	-	-
525	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Blue with White Streaks		NF	ACM	HM	S20	10-Mar-08	0.5% Chrysotile
525	Classroom	Wall	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	ND
525	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
525	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)		-	Non ACM	-	-	-	-
526	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Red/Brown with White and Brown Streaks		NF	ACM	SL	S55abc	10-Mar-08	1.4% Chrysotile
526	Classroom	Wall	Plaster	-		-	Non ACM	HM	S27	10-Mar-08	ND
526	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
526	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)		-	Non ACM	-	-	-	-
527	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Dark Grey/Brown with Brown and White		NF	ACM	SL	S52abc	10-Mar-08	1.2% Chrysotile
527	Classroom	Wall	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	ND
527	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
527	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)	-	Non ACM	-	-	-	-	-
528	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Green with White Streaks	NF	ACM	SL	S21abc	10-Mar-08	0.5% Chrysotile	
528	Classroom	Wall	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
528	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
528	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)	-	Non ACM	-	-	-	-	
530	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Brown with White and Brown Spots	-	Non ACM	SL	S53abc	10-Mar-08	ND	
530	Classroom	Wall	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
530	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
530	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
530	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole	-	Non ACM	HM	S13	10-May-18	ND	
531	Storage	Floor	Vinyl Floor Tile 12"x 12"	Brown with White and Brown Spots	-	Non ACM	SL	S53abc	10-Mar-08	ND	
531	Storage	Wall	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
531	Storage	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole	-	Non ACM	HM	S13	10-May-18	ND	
532	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Brown Dense Fleck (Post 2010)	-	Non ACM	-	-	-	-	
532	Classroom	Wall	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
532	Classroom	Wall	Concrete	-	-	Non ACM	-	-	-	-	
532	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
532	Classroom	Ceiling	Ceiling Tile 1' x 1'	Medium and Small Hole (Cellulose)	-	Non ACM	-	-	-	-	
533	Office	Floor	Vinyl Floor Tile 9"x 9"	Grey/Tan with White	NF	ACM	SL	S51abc	10-Mar-08	1.4% Chrysotile	
533	Office	Wall	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
533	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
533	Office	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole	-	Non ACM	HM	S13	10-May-18	ND	
533A	Staff Work Room	Floor	Vinyl Floor Tile 9"x 9"	Tan with Red and Black	NF	ACM	SL	S28abc	10-Mar-08	4.1% Chrysotile	
533A	Staff Work Room	Wall	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
533A	Staff Work Room	Wall	Drywall	Drywall Joint Compound	NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile	
533A	Staff Work Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole	-	Non ACM	HM	S01	10-May-18	ND	
533A	Staff Work Room	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole	-	Non ACM	HM	S13	10-May-18	ND	
533A	Staff Work Room	Ceiling	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
533B	Washroom	Floor	Vinyl Floor Tile 9"x 9"	Tan with Red and Black	NF	ACM	SL	S28abc	10-Mar-08	4.1% Chrysotile	
533B	Washroom	Wall	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
533B	Washroom	Ceiling	Plaster	-	-	Non ACM	HM	S19	10-Mar-08	ND	
533C	Washroom	Floor	Vinyl Floor Tile 9"x 9"	Tan with Red and Black	NF	ACM	SL	S28abc	10-Mar-08	4.1% Chrysotile	



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
533C	Washroom	Wall	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	ND
533C	Washroom	Ceiling	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	ND
534	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Dark Green with Green and White		NF	ACM	SL	S49abc	10-Mar-08	0.75% Chrysotile
534	Classroom	Wall	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	ND
534	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
534	Classroom	Ceiling	Ceiling Tile 2' x 4'	Dense Short Fissure Random Pinhole		-	Non ACM	SL	S50abc	10-Mar-08	ND
534	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole		-	Non ACM	HM	S13	10-May-18	ND
535	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Tan with Red and Black		NF	ACM	SL	S28abc	10-Mar-08	4.1% Chrysotile
535	Classroom	Wall	Plaster	-		-	Non ACM	HM	S02	10-Mar-08	ND
535	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
535	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
535	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole		-	Non ACM	HM	S13	10-May-18	ND
536	Classroom	Floor	Vinyl Floor Tile 9"x 9"	Light Brown with Brown and White		NF	ACM	SL	S48abc	10-Mar-08	1.2% Chrysotile
536	Classroom	Wall	Plaster	-		-	Non ACM	HM	S02	10-Mar-08	ND
536	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
536	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
536	Classroom	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole		-	Non ACM	HM	S13	10-May-18	ND
537	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Tan/Olive with White and Brown		NF	ACM	SL	S46abc	-	-
537	Classroom	Wall	Drywall	Drywall Joint Compound		-	Non ACM	HM	S01	-	-
537	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
537	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2000)		NF	Non ACM	-	-	-	-
537	Classroom	Ceiling	Ceiling Tile 1' x 1'	Thick Fissure Small Pinhole		-	Non ACM	HM	S45	10-Mar-08	ND
537A	Office	Floor	Vinyl Floor Tile 9"x 9"	Tan with Red and Black		NF	ACM	SL	S28abc	10-Mar-08	4.1% Chrysotile
537A	Office	Wall	Plaster	-		-	Non ACM	HM	S02	10-Mar-08	ND
537A	Office	Wall	Concrete	-		-	Non ACM	-	-	-	-
537A	Office	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
537A	Office	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole		-	Non ACM	HM	S13	10-May-18	ND
537B	Show Room	Floor	Carpet	-		-	Non ACM	-	-	-	-
537B	Show Room	Wall	Plaster	-		-	Non ACM	HM	S02	10-Mar-08	ND
537B	Show Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
537C	Kiln Room	Floor	Vinyl Floor Tile 9"x 9"	Tan with Red and Black		NF	ACM	HM	S28	10-Mar-08	4.1% Chrysotile
537C	Kiln Room	Wall	Plaster	-		-	Non ACM	HM	S02	10-Mar-08	ND



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
537C	Kiln Room	Wall	Concrete	-		-	Non ACM	-	-	-	-
537C	Kiln Room	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
537C	Kiln Room	Ceiling	Drywall	No Drywall Joint Compound		-	Non ACM	-	-	-	-
538	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Orange/Red with White		NF	ACM	SL	S30abc	10-Mar-08	5.0% Chrysotile
538	Classroom	Wall	Drywall	Drywall Joint Compound		-	Non ACM	HM	S01	-	-
538	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
538	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2000)		NF	Non ACM	-	-	-	-
538	Classroom	Ceiling	Ceiling Tile 1' x 1'	Thick Fissure Small Pinhole		-	Non ACM	HM	S45	10-Mar-08	ND
539	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Tan/Olive with White and Brown		NF	ACM	SL	S46abc	-	-
539	Classroom	Wall	Drywall	Drywall Joint Compound		-	Non ACM	HM	S01	-	-
539	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
539	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2000)		NF	Non ACM	-	-	-	-
539	Classroom	Ceiling	Ceiling Tile 1' x 1'	Thick Fissure Small Pinhole		-	Non ACM	HM	S45	10-Mar-08	ND
540	Classroom	Floor	Vinyl Floor Tile 12"x 12"	Olive and White		NF	ACM	SL	S44abc	10-Mar-08	2.4% Chrysotile
540	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
540	Classroom	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole (2000)		NF	Non ACM	-	-	-	-
540	Classroom	Ceiling	Ceiling Tile 1' x 1'	Thick Fissure Small Pinhole		-	Non ACM	SL	S45abc	10-Mar-08	ND
550	Classroom	Floor	Concrete	-		-	Non ACM	-	-	-	-
550	Classroom	Wall	Concrete	-		-	Non ACM	-	-	-	-
550	Classroom	Ceiling	Metal Pan	-		-	Non ACM	-	-	-	-
550	Classroom	Ducting	Flex Joint	-		NF	ACM	VC	-	-	-
550	Classroom	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
551	Projection Room	Floor	Vinyl Floor Tile 12"x 12"	Brown with Brown and White Fleck		-	Non ACM	HM	S53	13-Mar-08	ND
551	Projection Room	Wall	Concrete	-		-	Non ACM	-	-	-	-
551	Projection Room	Ceiling	Ceiling Tile 2' x 2'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
554	Fan Room (Above 555)	Floor	Concrete	-		-	Non ACM	-	-	-	-
554	Fan Room (Above 555)	Wall	Concrete	-		-	Non ACM	-	-	-	-
554	Fan Room (Above 555)	Ceiling	Metal Pan	-		-	Non ACM	-	-	-	-
554	Fan Room (Above 555)	Ducting	Flex Joint	-		NF	ACM	VC	-	-	-
554	Fan Room (Above 555)	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
555	Equipment Storage	Floor	Concrete	-		-	Non ACM	-	-	-	-
555	Equipment Storage	Wall	Concrete	-		-	Non ACM	-	-	-	-



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
555	Equipment Storage	Wall	Drywall	No Drywall Joint Compound	-	Non ACM	-	-	-	-	-
555	Equipment Storage	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
556	Fly Gallery	Floor	Concrete	-	-	Non ACM	-	-	-	-	-
556	Fly Gallery	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
556	Fly Gallery	Ceiling	Metal Pan	-	-	Non ACM	-	-	-	-	-
556	Fly Gallery	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
556	Fly Gallery	Wall	Transite	Asbestos Cement Board	NF	ACM	VC				
557	Mechanical Room	Floor	Concrete	-	-	Non ACM	-	-	-	-	-
557	Mechanical Room	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
557	Mechanical Room	Ceiling	Plaster	-	-	Non ACM	SL	S60abc	10-Mar-08	ND	
557	Mechanical Room	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
557	Mechanical Room	Ducting	Flex Joint	-	-	NF	ACM	VC	-	-	-
557	Mechanical Room	Piping	Pipe Insulation	Air Cell	F	ACM	HM	1680.894.04	11-Sep-90	>75% Amosite	
558	Duct Space	Floor	Concrete	-	-	Non ACM	-	-	-	-	-
558	Duct Space	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
558	Duct Space	Wall	Brick	-	-	Non ACM	-	-	-	-	-
558	Duct Space	Ceiling	Metal Pan	-	-	Non ACM	-	-	-	-	-
558	Duct Space	Ceiling	Drywall	Drywall Joint Compound	NF	ACM	SL	S61abc	10-Mar-08	1.3% Chrysotile	
558	Duct Space	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	
558	Duct Space	-	Texture Coat	Grey	-	Non ACM	SL	S62abc	10-Mar-08	ND	
559	Washroom	Floor	Vinyl Floor Tile 12"x 12"	Beige with Beige Fleck	-	Non ACM	HM	S57	10-Mar-08	ND	
559	Washroom	Wall	Plaster	-	-	Non ACM	HM	S27	10-Mar-08	ND	
559	Washroom	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole	-	Non ACM	HM	S13	10-May-18	ND	
560	Nurse's Office	Floor	Vinyl Floor Tile 9"x 9"	Grey with White and Grey Streaks	NF	ACM	HM	S59	10-Mar-08	1.5% Chrysotile	
560	Nurse's Office	Wall	Plaster	-	-	Non ACM	HM	S27	10-Mar-08	ND	
560	Nurse's Office	Wall	Plaster	-	-	Non ACM	HM	S27	10-Mar-08	ND	
561	Fan Room	Floor	Concrete	-	-	Non ACM	-	-	-	-	-
561	Fan Room	Wall	Concrete	-	-	Non ACM	-	-	-	-	-
561	Fan Room	Wall	Plaster	-	-	Non ACM	HM	S82	13-Mar-08	ND	
561	Fan Room	Ceiling	Metal Pan	-	-	Non ACM	-	-	-	-	-
561	Fan Room	Ducting	Flex Joint	-	-	NF	ACM	VC	-	-	-
561	Fan Room	Piping	Pipe Fitting	Parged Cement	F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile	



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
821	Corridor - 1966 Addition	Floor	Terrazzo	-		-	Non ACM	-		-	-
821	Corridor - 1966 Addition	Wall	Plaster	-		-	Non ACM	HM	S72, S82	13-Mar-08	ND
821	Corridor - 1966 Addition	Ceiling	Ceiling Tile 2 x 2	Short Fissure Random Pinhole		NF	ACM	-		-	-
821	Corridor - 1966 Addition	Ceiling	Ceiling Tile 2' x 2'	Large & Small Pinhole (Drywall)		-	Non ACM	-		-	-
821	Corridor - 1966 Addition	Above Ceiling	Drywall	No Drywall Joint Compound		-	Non ACM	-		-	-
821	Corridor - 1966 Addition	Firespray	Firespray	Colour Sprayed Applied (2021)		-	Non ACM	-		-	-
821	Corridor - 1966 Addition	Wall Cavities	Firespray	Sprayed Applied		F	ACM	HM	S06	13-Mar-08	4.1% Chrysotile
822	Corridor near 561	Floor	Vinyl Floor Tile 9"x 9"	Grey with White and Grey Streaks		NF	ACM	SL	S59abc	10-Mar-08	1.5% Chrysotile
822	Corridor near 561	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
822	Corridor near 561	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
823	Corridor - 1962	Floor	Terrazzo	-		-	Non ACM	-		-	-
823	Corridor - 1962	Wall	Plaster	-		-	Non ACM	HM	S19	10-Mar-08	ND
823	Corridor - 1962	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
823	Corridor - 1962	Ceiling	Ceiling Tile 2' x 4'	Textured Pinhole		-	Non ACM	SL	S54abc	10-Mar-08	ND
823	Corridor - 1962	Piping	Pipe Insulation	Fiberglass insulation		-	Non ACM	-		-	-
823	Corridor - 1962	Piping	Pipe Fitting	Parged Cement		F	ACM	HM	1680.894.03	11-Sep-90	50-75% Chrysotile
824	Corridor - 1972	Floor	Terrazzo	-		-	Non ACM	-		-	-
824	Corridor - 1972	Wall	Plaster	-		-	Non ACM	HM	S02	10-Mar-08	ND
824	Corridor - 1962	Ceiling	Ceiling Tile 1' x 1'	Large/Medium Pinhole		-	Non ACM	SL	S13ABC	10-May-18	ND
824	Corridor - 1972	Ceiling	Ceiling Tile 2' x 4'	Short Fissure Random Pinhole		-	Non ACM	HM	S01	10-May-18	ND
824	Corridor - 1966	Ceiling	Drywall	No Drywall Joint Compound		-	Non ACM	-		-	-
824	Corridor - 1966	Firespray	Firespray	Troweled-applied		F	ACM	SL	S06abc	10-Mar-08	4.1% Chrysotile
824	Corridor - 1972	Ducting	Duct Insulation	Fiberglass insulation		-	Non ACM	-		-	-
824	Corridor - 1972	Ducting	Flex Joint	-		NF	ACM	VC	-	-	-
901	Stairwell	Floor	Terrazzo	-		-	Non ACM	-		-	-
901	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S72, S82	13-Mar-08	ND
901	Stairwell	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-		-	-
901	Stairwell	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile
902	Stairwell	Floor	Terrazzo	-		-	Non ACM	-		-	-
902	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S72, S82	13-Mar-08	ND
902	Stairwell	Ceiling	Ceiling Tile 2' x 4'	Random Fissure Random Pinhole (2021)		-	Non ACM	-		-	-
902	Stairwell	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S81	10-Mar-08	1% Chrysotile



School Name	Legend:	Notes:
Waterloo-Oxford District Secondary School		All quantities provided on Figures, if known. Refer to the Asbestos Audit Update Report for condition of ACM and recommended actions.
Date Built:		
Original: 1955	HM - Homogenous Material - homogeneous with previously sampled material SL - Sample Location - Material Sampled VC - Visually Confirmed - Material not sampled, deemed ACM NF - Non-Friable	
Addition(s): 1958, 1962, 1966, 1971, 1972, 2000, 2001, 2011	F- Friable	Dates provided in Material Description/Room Description columns indicates date of installation/renovation and confirms the finishes as non-ACM.

WRDSB Fixed Reference Number	Room Description	Inspected Item	Inspected Material	Material	Description	Friability	Asbestos Classification	Sample / Identification Summary	Sample ID	Sample Date	% Asbestos & Fibre Type
903	Stairwell	Floor	Terrazzo	-		-	Non ACM	-		-	-
903	Stairwell	Wall	Concrete	-		-	Non ACM	-		-	-
903	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
903	Stairwell	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
904	Stairwell	Floor	Terrazzo	-		-	Non ACM	-		-	-
904	Stairwell	Wall	Concrete	-		-	Non ACM	-		-	-
904	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
904	Stairwell	Ceiling	Plaster	-		-	Non ACM	HM	S82	13-Mar-08	ND
906	Stairwell	Floor	Terrazzo	-		-	Non ACM	-		-	-
906	Stairwell	Wall	Concrete	-		-	Non ACM	-		-	-
906	Stairwell	Ceiling	Ceiling Tile 2' x 2'	Dense Fissure Small Pinhole		-	Non ACM	SL	S29abc	13-Mar-08	ND
906	Stairwell	Piping	Pipe Insulation	Fibreglass insulation		-	Non ACM	-		-	-
907	Stairwell	Floor	Vinyl Floor Tile 12"x 12"	Grey Dense Fleck (Post 2010)		-	Non ACM	-		-	-
907	Stairwell	Wall	Concrete	-		-	Non ACM	-		-	-
907	Stairwell	Ceiling	Drywall	Drywall Joint Compound		NF	ACM	HM	S61	10-Mar-08	1.3% Chrysotile
908	Stairwell	Floor	Terrazzo	-		-	Non ACM	-		-	-
908	Stairwell	Wall	Plaster	-		-	Non ACM	HM	S24, S43	10-Mar-08	ND
908	Stairwell	Wall	Concrete	-		-	Non ACM	-		-	-
908	Stairwell	Ceiling	Ceiling Tile 1' x 1'	Large and Small Pinhole		-	Non ACM	HM	S04abc	10-Mar-08	ND
908	Stairwell	Ceiling	Plaster	-		-	Non ACM	HM	S24, S43	10-Mar-08	ND
Summary of Potential ACM Hidden or Not Assessed											
300	Boiler Room	Boiler Refractory	Not Inspected								
	Throughout Building	Not Inspected	Not Inspected	Wall Cavity Insulation							
	Throughout Building	Not Inspected	Not Inspected	Door Core Insulation							

Appendix B

Figures

Original Building - Drywall Joint Compound is ACM
 Original Building - Floor Tile Mastic is ACM
 1958 Addition - Floor Tile Mastic is ACM
 1962 Addition - Drywall Joint Compound is ACM
 1962 Addition - Interior/Exterior Beige Window Sealant is ACM
 1966 Addition - Drywall Joint Compound is ACM
 1966 Addition - Interior/Exterior Beige Window Sealant is ACM
 1971 Addition - Floor Tile Mastic is ACM
 1972 Addition - Floor Tile Mastic is ACM
 1972 Addition - Interior/Exterior Beige Window Sealant is ACM
 1972 Addition - Interior Beige Door Sealant is ACM

NOTES:

ALL DRAWINGS TO BE REFERENCED WITH THE ASSOCIATED REPORT, LOCATIONS AND QUANTITIES ARE APPROXIMATE.

ALL KNOWN OR SUSPECT ASBESTOS-CONTAINING MATERIALS AND/OR DESIGNATED MATERIALS ARE NOT DEPICTED ON THIS DRAWING. REFER TO THE REPORT FOR A COMPLETE LIST OF IDENTIFIED MATERIALS.

THIS FIGURE IS COLOUR DEPENDENT, PHOTOCOPIES MAY ALTER INTERPRETATION OF THE FIGURE. ALWAYS REFER TO ORIGINAL DRAWINGS AND REPORT.

Legend

13 Fixed Reference Number

No Access

Post 1986 Construction

Asbestos-Containing Materials (ACM):

Floor Tile

Rolled Flooring

Ceiling Tile

Friable Soft Textured Ceiling

Non-Friable Hard Textured Ceiling

Spray-On Fire Proofing

Trowel Applied Fire Proofing

Transite (Asbestos Cement) Paneling

Duct Insulation

x2(1) Pipe Fitting Insulation w Quantity (Brackets Indicate # of Damaged Fittings)

Pipe Insulation (Vertical and Horizontal)

Transite (Asbestos Cement) Pipe (Vertical and Horizontal)

x2(1) Duct Expansion Joints w Quantity (Brackets Indicate # of Damaged Joints)

Friable Debris



Ph. (519) 743-6500 www.mte85.com


CLIENT WATERLOO REGION DISTRICT SCHOOL BOARD

PROJECT 2021 ASBESTOS AUDIT UPDATE

DRAWING WATERLOO-OXFORD DISTRICT SECONDARY SCHOOL

LEVEL ONE

Project Manager	P. Semeniuk	Date	November 2021
Design By	WRDSB	Project No.	34532-921
Drawn By	P. Semeniuk	Drawing No.	
Scale	N.T.S.		1.0

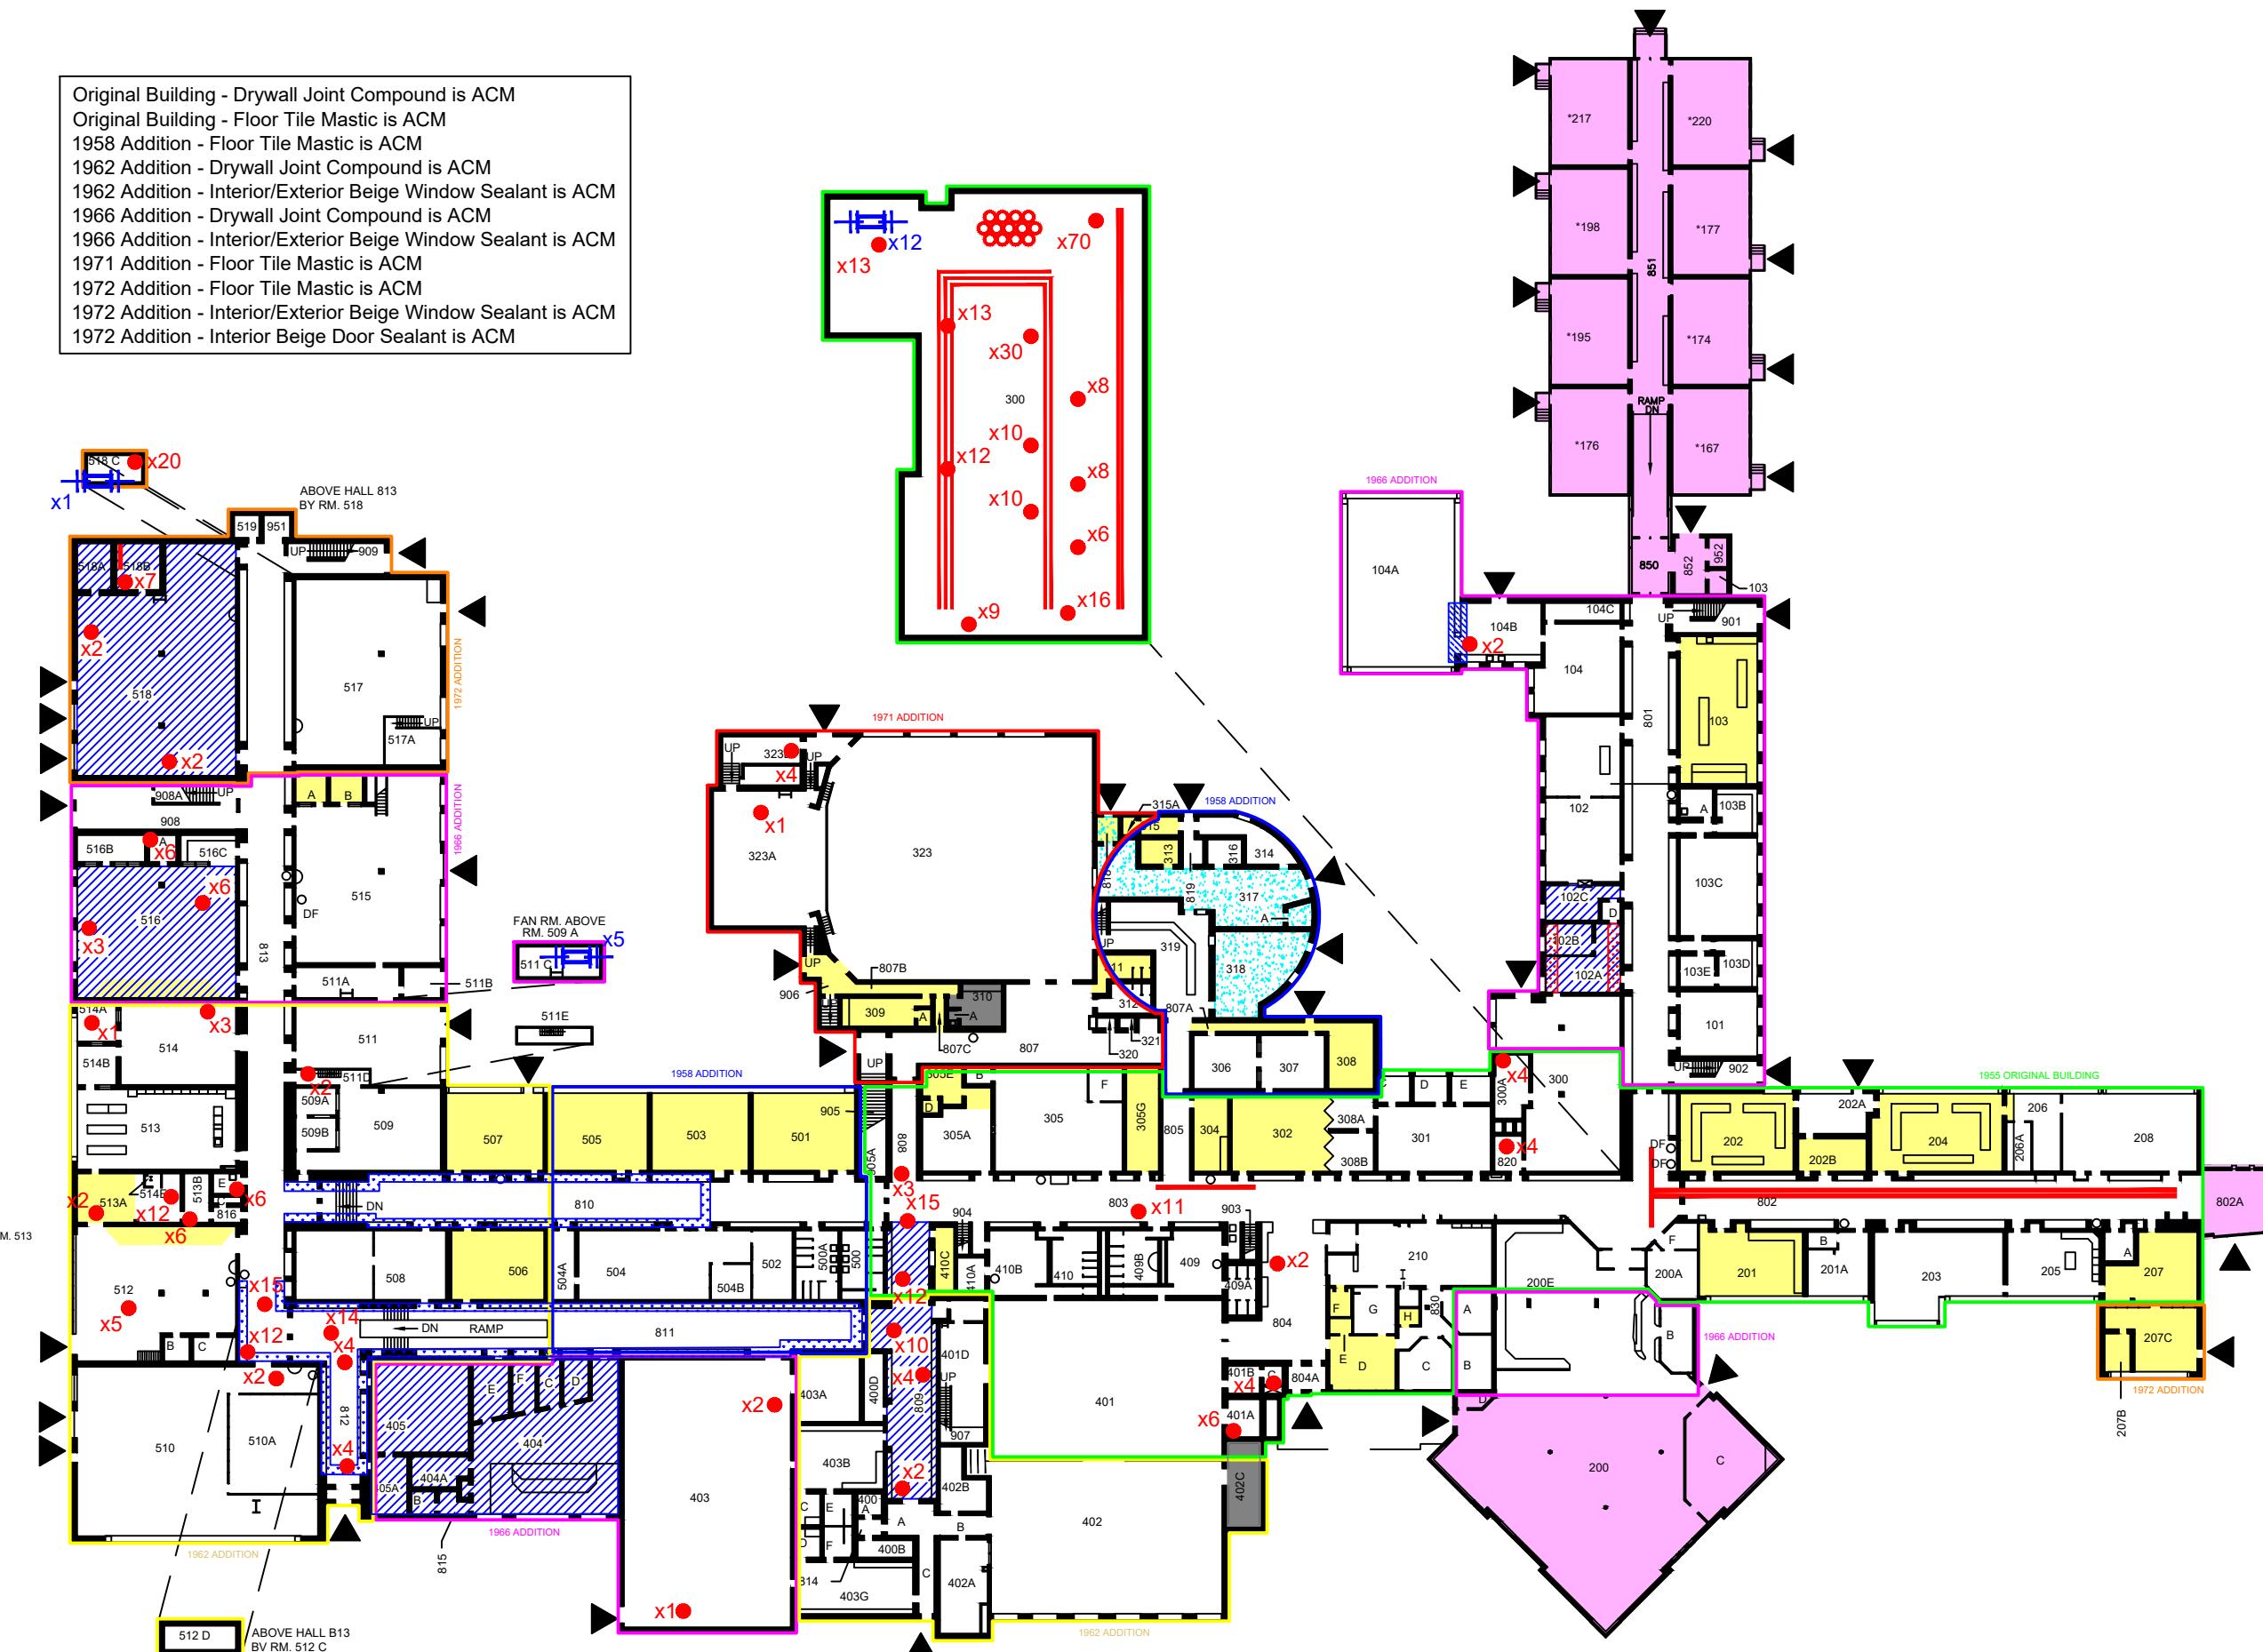

Original Building - Drywall Joint Compound is ACM
 Original Building - Floor Tile Mastic is ACM
 1958 Addition - Floor Tile Mastic is ACM
 1962 Addition - Drywall Joint Compound is ACM
 1962 Addition - Interior/Exterior Beige Window Sealant is ACM
 1966 Addition - Drywall Joint Compound is ACM
 1966 Addition - Interior/Exterior Beige Window Sealant is ACM
 1971 Addition - Floor Tile Mastic is ACM
 1972 Addition - Floor Tile Mastic is ACM
 1972 Addition - Interior/Exterior Beige Window Sealant is ACM
 1972 Addition - Interior Beige Door Sealant is ACM

NOTES:

ALL DRAWINGS TO BE REFERENCED WITH THE ASSOCIATED REPORT, LOCATIONS AND QUANTITIES ARE APPROXIMATE.

ALL KNOWN OR SUSPECT ASBESTOS-CONTAINING MATERIALS AND/OR DESIGNATED MATERIALS ARE NOT DEPICTED ON THIS DRAWING. REFER TO THE REPORT FOR A COMPLETE LIST OF IDENTIFIED MATERIALS.

THIS FIGURE IS COLOUR DEPENDENT, PHOTOCOPIES MAY ALTER INTERPRETATION OF THE FIGURE. ALWAYS REFER TO ORIGINAL DRAWINGS AND REPORT.

Legend

13 Fixed Reference Number

No Access

Post 1986 Construction

Asbestos-Containing Materials (ACM):

Floor Tile

Rolled Flooring

Ceiling Tile

Friable Soft Textured Ceiling

Non-Friable Hard Textured Ceiling

Spray-On Fire Proofing

Trowel Applied Fire Proofing

Transite (Asbestos Cement) Paneling

Duct Insulation

x2(1) Pipe Fitting Insulation w Quantity (Brackets Indicate # of Damaged Fittings)

● Pipe Insulation (Vertical and Horizontal)

○ Transite (Asbestos Cement) Pipe (Vertical and Horizontal)

x2(1) Duct Expansion Joints w Quantity (Brackets Indicate # of Damaged Joints)

Cloud Friable Debris



Ph. (519) 743-6500 www.mte85.com


CLIENT
WATERLOO REGION DISTRICT SCHOOL BOARD

PROJECT
2021 ASBESTOS AUDIT UPDATE

DRAWING
WATERLOO-OXFORD DISTRICT SECONDARY SCHOOL

LEVEL TWO

Project Manager	P. Semeniuk	Date	November 2021
Design By	WRDSB	Project No.	34532-921
Drawn By	P. Semeniuk	Drawing No.	
Scale	N.T.S.		2.0

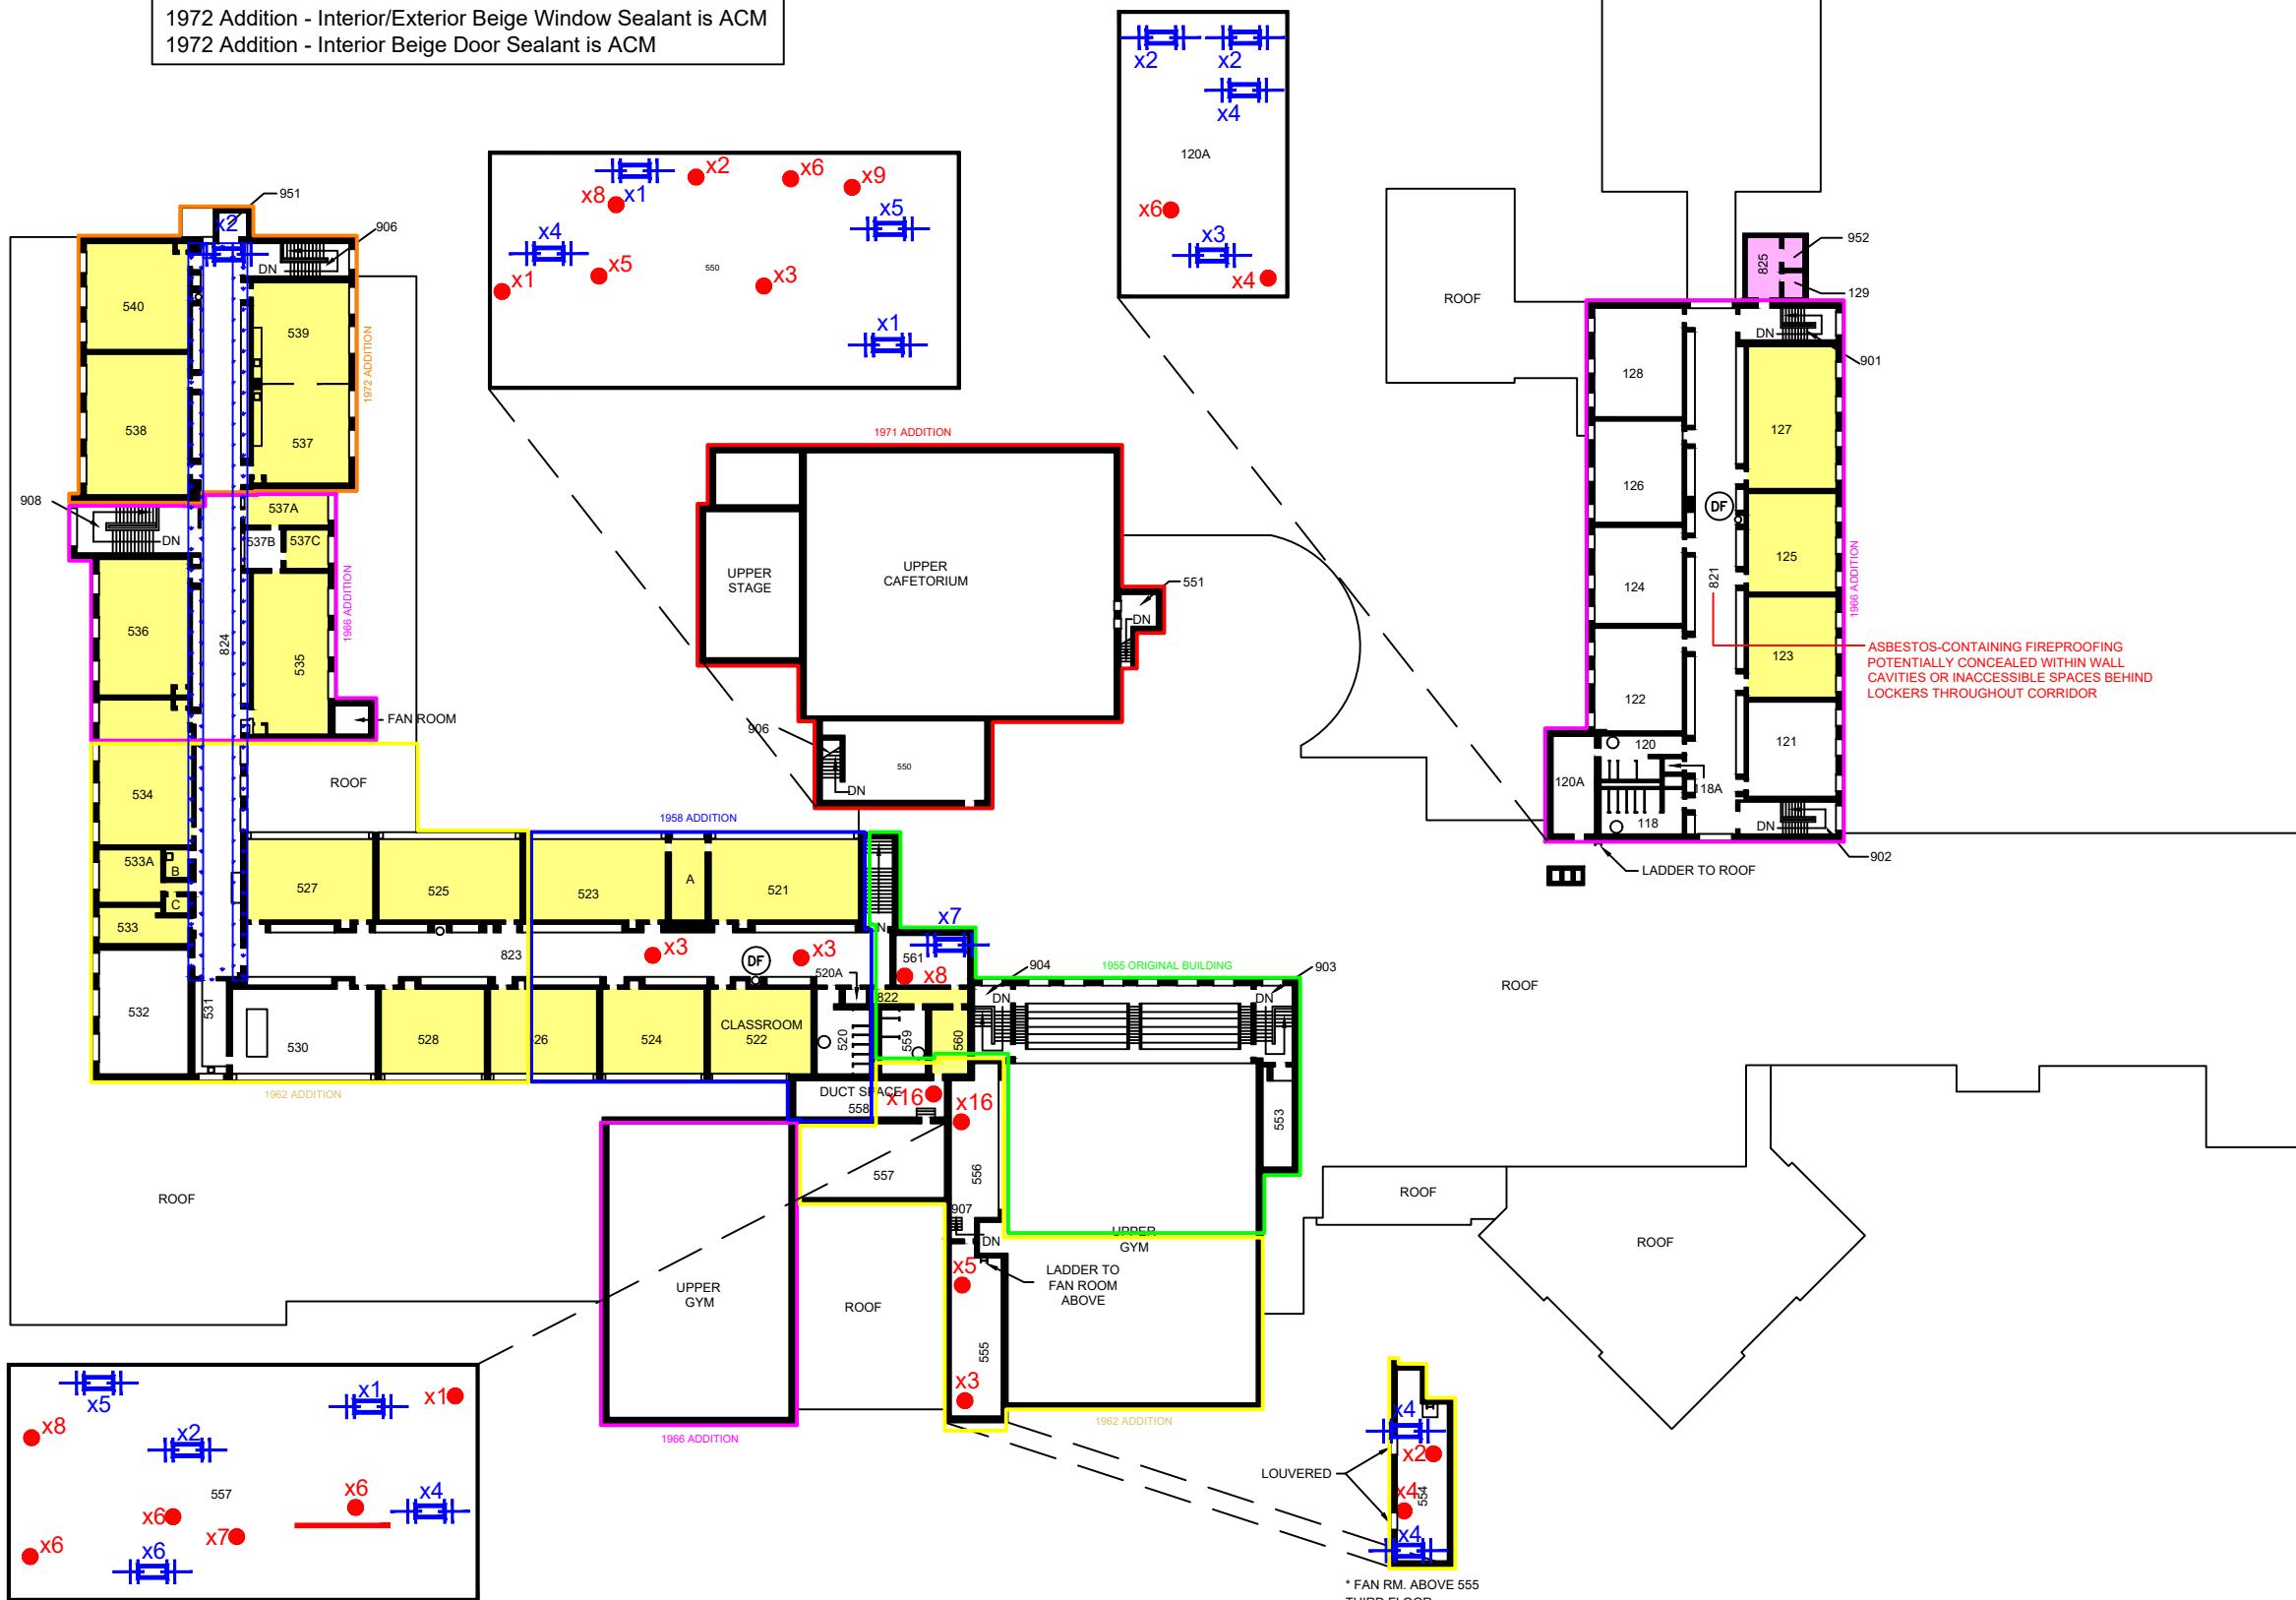

Appendix C

Tables

TABLE 1 - INTERNAL ABATEMENT MANAGEMENT						
Waterloo Oxford Secondary School						
Material	WRDSB Fixed Reference Number	Material Description	Approximate Quantity	Photograph - Context	Photograph - Detail	Required Action
Asbestos Non-Friable	103	9" x 9" Tan Floor Tile	2 tiles			Monitor Annually
Asbestos Non-Friable	125	9" x 9" Green Floor Tile	5 Tiles			Monitor Annually
Asbestos Non-Friable	200	Drywall	<1 m ²			Monitor Annually
Asbestos Non-Friable	200	Drywall	<1 m ²			Monitor Annually
Asbestos Non-Friable	207	12"x12" beige Floor Tiles cracking and degrading at floor seam	40 tiles			Removal in accordance with O. Reg. 278/05 as a Type 1 Operation

Table 1 and 2 - Damaged Materials - Waterloo Oxford District Secondary School

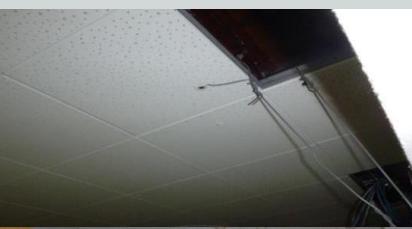
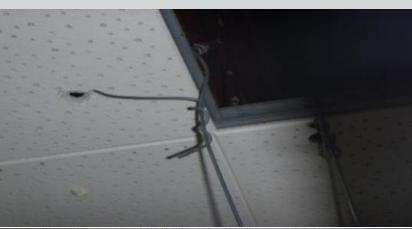
TABLE 1 - INTERNAL ABATEMENT MANAGEMENT						
Waterloo Oxford Secondary School						
Material	WRDSB Fixed Reference Number	Material Description	Approximate Quantity	Photograph - Context	Photograph - Detail	Required Action
Asbestos Non-Friable	101, 102, 102A, 102B, 103, 103C, 103F, 104, 122, 124, 126, 128	1' x 1' Ceiling Tiles - Damage at hangers and penetrations	Throughout			Monitor Annually
Asbestos Non-Friable	404B	1' x 1' Ceiling Tiles	19 tiles			Removal in accordance with O. Reg. 278/05 as a Type 1 Operation
Asbestos Non-Friable	802 at room 206	Drywall	<1 m ²			Monitor Annually
Asbestos Non-Friable	807B	12"x12" orange Floor Tiles	3 Tiles			Monitor Annually
Asbestos Non-Friable	809	2' x 2' Ceiling Tiles - Dense Fissure Random Pinhole	15+ Tiles			Removal in accordance with O. Reg. 278/05 as a Type 1 Operation

Table 1 and 2 - Damaged Materials - Waterloo Oxford District Secondary School

TABLE 1 - INTERNAL ABATEMENT MANAGEMENT						
Waterloo Oxford Secondary School						
Material	WRDSB Fixed Reference Number	Material Description	Approximate Quantity	Photograph - Context	Photograph - Detail	Required Action
Asbestos Non-Friable	822	Exposed Mastic	14 tiles			Repair/Removal in accordance with O. Reg. 278/05 as a Type 1 Operation
Asbestos Non-Friable	906	12"x12" orange Floor Tiles	2 Tiles			Monitor Annually

Notes:

1) A copy of this report should be provided to all prospective contractors prior to tender or quotation, in accordance with Section 30 of the Occupational Health and Safety Act.

2) Recommended actions are the minimum required actions, as prescribed by the appropriate Acts, regulations, guidelines, standards, codes and general best practice measures. The Contractor may choose to alter the approach and combine or break out sections of work. This is acceptable provided that the appropriate Acts, regulations, guidelines, standards and codes are followed and afford protection for the health and safety of workers, occupants and the public that is at least equal to the protection that would be provided by complying with the minimum requirements.

3) All waste generated is subject to characterization and disposal in accordance with Ontario Regulation 347.

TABLE 2 - EXTERNAL ABATEMENT MANAGEMENT

Waterloo Oxford Secondary School						
Material	WRDSB Fixed Reference Number	Material Description	Approximate Quantity	Photograph - Context	Photograph - Detail	Required Action
Asbestos Friable	104B	Insulation on Pipe Fittings	2			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation
Asbestos Friable	300	Insulation on Pipe Fittings	2			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation
Asbestos Friable	300	Insulation on Pipe Fittings	1			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation
Asbestos Friable	300	Insulation on Pipe Fittings	1			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation
Asbestos Friable	300	Insulation on Pipe Fittings	1			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation

Table 1 and 2 - Damaged Materials - Waterloo Oxford District Secondary School

TABLE 2 - EXTERNAL ABATEMENT MANAGEMENT						
Waterloo Oxford Secondary School						
Material	WRDSB Fixed Reference Number	Material Description	Approximate Quantity	Photograph - Context	Photograph - Detail	Required Action
Asbestos Friable	300	Insulation on Pipe Fittings	2			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation
Asbestos Friable	300	Insulation on Pipe Fittings	1			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation
Asbestos Friable	300	Insulation on Pipe Fittings	1			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation
Asbestos Friable	300	Insulation on Pipe Fittings	1			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation
Asbestos Non-Friable	518	2" x4" Ceiling Tiles	30+ Tiles			Removal in accordance with O. Reg. 278/05 as a Type 2 Operation

Table 1 and 2 - Damaged Materials - Waterloo Oxford District Secondary School

TABLE 2 - EXTERNAL ABATEMENT MANAGEMENT						
Waterloo Oxford Secondary School						
Material	WRDSB Fixed Reference Number	Material Description	Approximate Quantity	Photograph - Context	Photograph - Detail	Required Action
<p>Notes:</p> <p>1) A copy of this report should be provided to all prospective contractors prior to tender or quotation, in accordance with Section 30 of the Occupational Health and Safety Act.</p> <p>2) Recommended actions are the minimum required actions, as prescribed by the appropriate Acts, regulations, guidelines, standards, codes and general best practice measures. The Contractor may choose to alter the approach and combine or break out sections of work. This is acceptable provided that the appropriate Acts, regulations, guidelines, standards and codes are followed and afford protection for the health and safety of workers, occupants and the public that is at least equal to the protection that would be provided by complying with the minimum requirements.</p> <p>3) All waste generated is subject to characterization and disposal in accordance with Ontario Regulation 347.</p>						